

ACCENT HOUSING - FIRE RISK ASSESSMENT



Region: South

Scheme Name: 6-16 Deanside

Scheme Address : Deanside, Camberley

Camberley GU15 4DZ

Date of Assessment: 11/10/2022

Date of Next Assessment: 11/10/2025

FRA Frequency: 3 Year Re-Assessment

Fire & Safety Assessor Gary Bredin

This Fire Risk Assessment has been conducted upon the instruction of Accent Housing.

Scheme Details		6-16 Deanside
Region:		South
Scheme Name:		6-16 Deanside
Site Address:	Street:	Deanside, Camberley
	Town:	Camberley
	Post Code:	GU15 4DZ
Block & Asset No.		Block 6-16 Asset No.25220
Scheme Tel. No:		-
Date of this Assessment		11/10/2022
Date of Next Review		11/10/2025
Fire Risk Assessment Frequency		3 Years
Health & Safety Assessment Frequency	У	3 Years
Purpose of Fire Risk Assessment		3 Year Re-Assessment
Fire & Safety Assessor		Gary Bredin
Director of Customer Experience		Louise Graham Smith.
Customer Partnership Manager		Nathalie Antoinet
Contract Manager		-
Scheme Manager/Customer Partner		Paul Hills
Other staff in attendance		-
Use of Building		General Needs
Approximate Number of occupants		20
Occupancy Profile		Families
Familiarity of the occupants		Slightly Familiar
Likely state of the Occupants		Alert
PEEPs in place where necessary		N/A
Number of on-site Accent staff		None
		Contract cleaners in common
Number of other (non-Accent) staff		areas
Support Agency (Supported Housing)		N/A
Current Evacuation Strategy.		Stay Put (Delayed) Evacuation
Evidence that residents have been noti	ified of the	Advice notices displayed in
evacuation procedure		common areas
History of fires in the building		None
Business Continuity Plan in place?		Yes
		Type 3 (Common Parts & Flats -
Scope of Assessment		Non Destructive)
		Sleeping Accommodation Guide
Applicable Fire Safety Guidance		D 1 31 (1 : 1 : 1
		Purpose-built flats guide

Building Details	6-16 Deanside
Construction Date	2005
	Joisted or Load Bearing Masonry
Construction Type	(Traditional)
Roof Finish	Pitched-Clay Tile
External Wall Finish	Brick
	Cement Render
Are there any areas of external wall cladding	No
Are there any balconies	No
Conversion or purpose-built	Purpose Built
Number of flats (self-contained)/rooms (HMOS, shared	4 self contained flats accessed
houses)	from common area
Number of storeys above ground	Three
Number of storeys below ground	None
Is there a habitable basement?	N/A
Number of internal Staircases per Block	
(protected or unprotected?)	One-Protected
Number of External Staircases per Block	None
External Balcony part of escape route?	N/A
Unusual features	None
Building complexity	Simple
Building Access Conditions for Fire Brigade	Vehicular Access to one or more
	elevations
Surroundings: Residential/Commercial	Residential
Fire Provision Currently in P	
Fire Detection and Warning System	Flats only
Grade of fire alarm	Grade D
Category of fire alarm	LD3 Minimum Protection
Additional Comments:	-
Evacuation Alert System (EAS)	N/A
Additional Comments:	No. Maintain ad Overtons
Emergency Lighting Provision	Non Maintained System -
Additional Comments:	Common Areas
Portable Fire Extinguishers	None fitted
ortable i lie Extiliguishers	None inted
Additional Comments:	
Fixed Fire Fighting Installations	None fitted
Additional Comments:	TVOTE TILLED
Additional Comments.	

Significant Findings - Fire								
	6-16 C		<u> </u>		11/10/2022			
Action Ref:	Potential Area of Fire Risk	Yes-No-N/A	Observation/Comments/ Actions Required	Risk Rating	Target Completion Date	Referred To:		
			Fire Hazards					
1	Electrical Sources of Ignition:							
1.1	Electrical Installation within common areas (Fixed Wiring, sockets, switches, light fittings) in good condition and no obvious damage	Yes	All common area sockets and fittings in a satisfactory condition at the time of inspection.					
1.2	Valid Electrical Installation Condition Reports held on file.(Common Areas)	Yes	Commission an electrical safety inspection completed and uploaded to the property file.					
1.3	Valid Electrical Installation Condition Reports held on file. (General Needs Flats)	Yes						
1.4	Electrical App/PA Testing - all portable appliances tested within past 12 months	N/A	PAT not required, no portable electrical equipment in communal areas					
1.5	Absence of trailing leads and adapters	Хes		-				
1.6	Mobility Scooters - Stored/charged in common areas, purpose built store/resident flat	oN						
2	Smoking:							
2.1	Are there any risks associated with smoking in the building?	N _o	No smoking policy within common areas					
3	Arson:							
3.1	Adequate security against arson?	Yes	Building secure - Intercom door entry system with trade button access.	1				
3.2	Is there an absence of unnecessary fire load in close proximity to building?	Yes	All external common areas clear at time of inspection	1				

4	Heating Installations (Portable/fixed)								
	Gas Installations - Common Areas & Gener	al Ne	eeds Residential flats.						
4.1	If portable heaters are used, are there	N/A	No portable heaters permitted in communal areas						
	suitable controls?	Z		'					
4.2	Are fixed heating installations subject to	N/A							
	regular maintenance?	Ž							
4.3	Valid LGSC held on file for each residential	N/A		١.					
	flat that contains gas appliances.	Ž		•					
5	Cooking:								
5.1	Are reasonable measures taken to prevent	N/A	No communal cooking areas						
	fires as a result of cooking?	Ž		•					
5.2	Where there is extraction ventilation in								
	communal kitchens are filters changed/	N/A		٠.					
	cleaned and ductwork cleaned regularly?								
6	Lightning Protection System:								
6.1	Does the building have a lightning protection		According to the lightning protections regulations						
	system, If so, is it adequately maintained?	_	(as satiated in the RC 35 'Protection of buildings						
		N/A	against lightning strikes'), it is not a legal	٠ ا					
			requirement for buildings to be fitted with lightning						
			protection.						
7	Housekeeping:								
7.1	Is the standard of housekeeping adequate?	% 8	Fly tipping outside no 8 and 12. CP to organise	Med	1/12/22	Partnership			
		Ν	removal.	ŭ	1/12/22	Manager 1			
7.2	Are all electrical/intake/service cupboards		All cupboards secure and clear at time of						
	secure and free from general waste,	Yes	inspection	١.					
	contractors waste and residents personal	×		'					
	items.								
7.3	Are combustible materials separated from	A							
	ignition sources and stored appropriately?	W/A							
7.4	Are unnecessary accumulations of	Yes							
	combustible materials or waste avoided?	×							

7.5	Are hazardous materials stored appropriately (i.e. oxygen cylinders, flammable materials, explosive products, oxidising products, aerosols) Furniture/furnishings on escape routes and	∀/N	No hazardous materials stored on site.		
8.1	Furniture/furnishings on escape routes and Furniture/furnishings in good condition, fire retardant and complies with 1988 Regulations.	A/N	No furniture allowed in the common areas.		
9	Other Significant Fire Hazards:				
9.1	Are there other significant fire hazards that are inadequately controlled?	No		ı	
		Fire	e Protection Measures		
10	Means of Escape from Fire:				
10.1	Is it considered that the building is provided with reasonable means of escape in case of fire?	Yes	Main entrance primary escape route. Additional exit provided to the rear of the building		
10.2	Escape routes unobstructed and safe to use?	No	See note 7.1	ı	
10.3	Exits easily and immediately openable where necessary, without a key?	Yes	All exit doors are of the push bar, push pad or thumb turn type	ı	
10.4	Reasonable distances of travel where there is a single/alternative direction of travel?	Yes	All escape routes are within permissible distances some extra signage installed during inspection by	-	
10.5	Escape routes lead to final exits and open in direction of escape where necessary?	Yes		•	
	Do failsafe's on locked exit doors function correctly?	Yes	Some needed minor attention (completed during the inspection) by the Assessor.	,	
	Is it considered that the building is provided with reasonable arrangements for means of escape for disabled people?	No	Ground floor areas only are suitable for disabled access/egress.		
	Measures to Limit Fire Spread and Develop	men	t:		
11.1	Is it considered that the compartmentation is of a reasonable standard?	Yes			

11.2	Is there reasonable limitation of surface finishes that might promote fire spread (walls,	Yes				
	floors, ceilings)?	ĺ				
11.3	Are fire dampers/shutters provided in ducts/refuse chutes to protect means of escape against fire, smoke and combustion products?	A/N				
11.4	Compartmentation within roof spaces of a satisfactory standard?	Other	Findings previously submitted to compartment survey project	ı		
11.5	Loft hatches fire resisting?	Yes	Communal area roof hatch's are close fitting and of 1hr fire rated steel construction.			
	Fire stopping above cross-corridor fire doors within suspended ceiling void of a satisfactory standard	N/A		•		
11.7	Smoke Control Systems (AOV's) Are records of annual testing available?	N/A				
11.8	Roller shutter doors (fire resisting)	N/A		ı		
11.9	Do the external walls, windows, balconies etc pose a risk of significant fire spread?	οN				
12	Communal Area Fire Doors (Inspection to i	nclu	de - construction, hinges, closure devices, intum	esce	nt/smoke s	eal condition,
	glazing systems and maximum gaps betwe	en d	oor and frame.			
12.1	Communal fire doors to FD30s standard and in a serviceable condition,	Yes	All communal fire doors were found to be in good condition and conforming to the latest British Standard.	•		
12.2	"Fire door keep shut/locked" signage displayed on both sides of all applicable doors.	Yes	Some signs were missing and were replaced/updated during the inspection.	-		
12.3	Hold open devices operate at the sounding of the alarm and are in a serviceable condition	N/A		-		
13	Flat entrance doors (Internal Common Area	ıs)				
13.1	Do flat entrance doors open onto internal escape routes?	Yes	If yes, see "Residents Front Doors Sheet"	ı		
_		_		_	_	

14	Flats with a single direction of escape to a	sina	le escape stairway. (External Balcony)			
	Do the flat entrance doors that open onto an external balcony have to be passed during an escape?		If yes, see "Residents Front Doors Sheet"			
14.2	Are the separating walls between the flats and the balcony floor that have to be passed during an escape, fire-resisting up to a height of 1.1m?	N/A		•		
15	Emergency Escape Lighting:					
15.1	Is the emergency lighting correctly specified and installed as per BS 5266-1:2016	Yes	Non-maintained emergency lighting is installed within all escape routes			
15.2	Are all emergency lighting units in good condition and securely fixed to walls/ceilings	Yes	All emergency lights fixed to the ceiling and walls.			
15.9	Are records of monthly testing available?	Yes	Annual test certs uploaded to P Drive			
15.10	Are records of annual testing available?	Yes	Annual test certs uploaded to P Drive - Maintenance program in place	ı		
16	Fire Safety Signs and Notices:					
16.1	Are the correct Fire Action/Advice notices displayed in prominent locations within the common areas?	Sə	Signage checked and updated during inspection	•		
16.3	Directional fire escape signage in place and adequate?	Yes	Signage checked and updated during inspection	•		
	Is there a suitable LIFT sign i.e. do not use in case of fire.	N/A		ı		
	Means of giving Warning in case of Fire:					
17.1	Is the fire detection and warning system appropriate for the occupancy and fire risk?	Yes	All flats have smoke detection to LD3 standard. An additional heat detector is located in the flats. There is single point smoke detection located in the communal areas on each floors. This contradicts the evacuation policy and should be removed.	Low	1/2/22	Fire Safety Manager

17.2	Is the fire detection and warning system correctly specified and installed as per BS 5839-1:2017	N/A			
17.3	Is the fire detection and warning system maintained/tested and all certificates saved on file. (BS 5839-1:2017)	N/A			
17.4	Are there heat detectors located in the Kitchen, Boiler, Plant Room and Laundry?	N/A			
17.5	Is the fire alarm panel remotely monitored, and if so are there records of regular testing?	N/A		-	
17.6	Are smoke/heat detectors within General Needs flats subject to an annual inspection and the results recorded on an in date Landlord Gas Safety Record (LGSR)	Yes	A contract is in place with Tunstall to annually test the detection within each flat.	,	
18	Fire Extinguishing Equipment:				
	Portable fire extinguishers - appropriate type/number/position?	N/A	No Fire Extinguishers on site.	-	
18.2	Correct signage displayed by each fire extinguisher?	N/A		-	
	Fire blanket in communal kitchen, secured to the wall, complete with signage?	N/A		-	
18.4	Hose Reels - fitted, maintained?	N/A	None fitted		
18.5	Dry/wet risers - Full access to all inlet/outlet boxes. All inlet/outlets secured and/or securing straps fitted to outlet valves?	N/A	None fitted	-	
18.6	Records available of fire fighting equipment	A			
	servicing within past 12 months	N/A		'	

19.1	Are there suitable arrangements for summoning the fire service?	Yes	It is the responsibility of our customers to raise the alarm and call the Emergency Services.	ı	
19.2	Do relevant staff carry out regular fire safety checks	Yes	Regular inspections are made by the Customer Partner and any works orders are raised	•	
19.3	Sheltered Schemes & Regional Offices - Are there sufficient number of qualified Fire wardens.	N/A		•	
19.4	Offices - Are there suitable arrangements for ensuring the premises are evacuated?	N/A		ı	
19.5	Offices - Are there suitable arrangements for evacuating disabled people?	N/A		ı	
19.6	Offices - Are there suitable arrangements for meeting the fire service on arrival and providing relevant information?	N/A		ı	
19.7	Offices/IL Schemes - Is there a suitable assembly point?	N/A		-	
19.8	Offices - Are fire drills carried out at appropriate intervals?	N/A		-	
20	Evacuation Policy				
20.1	Taking the findings of the FRA into account, is the evacuation policy appropriate for the scheme?	SәД	Stay put (delayed) evacuation policy in operation for residents within their flats. Residents instructed to fully evacuate if they are in a communal area.		

Residents Front Doors

6-16 Deanside

11/10/2022

Flat entrance doors to FD30s specification (Inspection to include - Door condition, construction, closure devices, intumescent/smoke seal condition, glazing systems, fire rated letterplate, door furniture and maximum gaps between door and frame/threshold.

Flat No.	Access Gained	Asset No.	Observation/Comments / Actions Required	Risk Rating	Completion Date	Referred To:
6	No		No requirement to be FD30 door - External entrance	-		
8	Yes		Inspection caried out. Door set operating as designed and in good condition.	-		
10	No		Unable to gain access. External visual inspection only. Condition good.	-		
12	No		Unable to gain access. External visual inspection only. Condition good.	-		
14	No		Unable to gain access. External visual inspection only. Condition good.	-		
16	No		No requirement to be FD30 door - External entrance	-		

Photographs - Fire 11/10/2022 6-16 Deanside



Photo No. 1

Observation - Notice board showing evacuation policy .





Photo No. 2

Observation - Emergency action signage.

Photographs - Fire						
11/10/2022	6-16 Deanside					

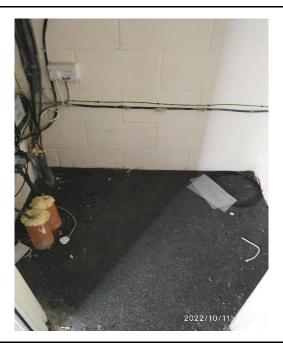


Photo No. 3

Observation - Electrical cupboards clear at the time of the audit.



Photo No. 4

Observation- Loft hatch metal construction tight fitting an locked shut.


Photographs - Fire 11/10/2022 6-16 Deanside






Photo No. 5

Observation- Fly tipping on the first and second floors. CP to deal.

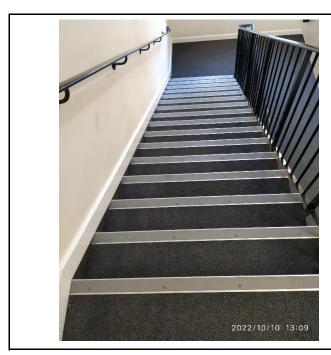

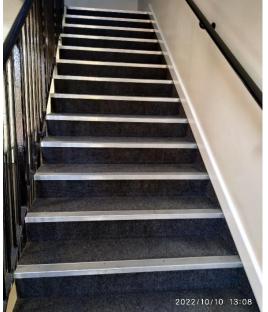

Р	h	O	to	1	V	O	 ദ

Observation - Stair treads and risers were found to be in good order.

Photographs - Fire					
11/10/2022	6-16 Deanside				





Photo No. 7

Observation - External electronic door entry system in place and manual on exit. Thumb turn exit sign installed during the audit.

6. Risk Calculator - Fire

The following risk estimator is based on the general health and safety risk level estimator contained within BS 8800: 1996. Guide to occupational health and safety management systems.

1. Taking into account the fire prevention measures observed at the time of this risk assessment, it is considered that the hazard from the fire (the probability of ignition) at this building is:

(please insert x below)

LOW MEDIUM X HIGH

2. Taking into account the nature of the building, the occupants, the fire protection afforded and any procedural arrangements observed at the time of the assessment, it is considered that the consequences for life safety in the event of a fire would be:

(please insert x below)

MINOR X MAJOR CRITICAL	MINOR	X	MAJOR		CRITICAL	
------------------------	-------	---	-------	--	----------	--

The definition of the above terms is as follows:

FRA Review Frequency

MINOR	Outbreak of fire is unlikely to result in serious injury or death of any occupant				
	(other than the occupant sleeping in a bedroom in which a fire occurs).				
MAJOR	An outbreak of fire could result in injury of one or more occupants, but is unlikely				
	to lead to fatalities.				
CRITICAL	There is significant potential for serious injury or death of one or more occupants.				

3. The above estimates are then read into the following matrix table to give the overall risk level for the site:

Fire Hazard	Minor	Major	Critical
Low	Trivial	Tolerable	Moderate
Medium	Tolerable	Moderate	Substantial
High	Moderate	Substantial	Intolerable

When the level of risk is established, the action level can be read from the table below:

Risk Level	Guide to actions and appropriate timescales					
Trivial	No action is required					
	Efforts should be made to reduce the risk level and this should be carried out within the specified time periods.					
Substantial	Considerable resources may have to be allocated to reduce the risk level. It may be necessary to limit the occupation of some parts until urgent remedial action is					
Intolerable	The building (or the relevant area) should not be occupied until the risk is reduced.					

Action Plan - Fire							
6-16 Deanside			11/10/2022				
Medium							
Housekeeping:							
Is the standard of housekeeping adequate?	Fly tipping outside no 8 and 12. CP to organise removal.	Med	01/12/22	Partnership Manager 1	Tasked to Customer Partner Direct.		
Means of giving Warning in case of Fire:							
Is the fire detection and warning system appropriate for the occupancy and fire risk?	All flats have smoke detection to LD3 standard. An additional heat detector is located in the flats. There is single point smoke detection located in the communal areas on each floors. This contradicts the evacuation policy and should be removed.	Low	01/02/22	Fire Safety Manager			

Action Plan - Fire Page 17 of 18

Action Plan - Residents Front Doors						
6-16 Deanside				11/	10/2022	
Flat No.	Asset Observation/Comments / Actions No. Required		Risk Rating	Completion Date	Referred To:	Task ID No.
		NO ACTIONS RAISED	-			