

This report shows all the responses to the Fire Risk Assessment survey, including raised tasks.

Asset ID: 9029 **4 Spa Lane Block 1-3 Spa Lane, Harrogate**

Cover Sheet

Photo



Date of Fire Risk Assessment	01 Aug 2024
Date of Next Fire Risk Assessment	01 Aug 2025
FRA Frequency (Months)	12
Purpose of Fire Risk Assessment	Annual Re-Assessment
Type of Fire Risk Assessment	Type 1 (Common Parts Only - Non Destructive)
Fire & Safety Assessor	Kevin Jones GFireE Level 4 Certification in Fire safety Fire Auditor

It is sensible to have arrangements in place to ensure the consistency of Fire Risk Assessments in terms of the assessment of risk and mitigations proposed. In this regard Accent peer validate around 20% of reports, which are available within our audit system.

The Scheme

Scheme Name	Spa Lane
Scheme Address	4 Spa Lane Block 1-3 Spa Lane, Harrogate
Postcode	HG2 7JF
Region	North East
Scheme Manager	
Scheme Tel. No	
Scheme Inspection Completed	Yes
Enforcing Fire Authority	North Yorkshire
Other staff in attendance	None
Number of on-site Accent staff	Scheme Manager Weekdays
Number of other (non-Accent) staff	

The Building

Accommodation Type	General Needs (S30)
Build Date	Jan 1 1920
Number Of Homes	3
Homes breakdown	Flat
External wall construction	Facing Brick
External wall finish	Cement Render, Facing Brick
Roof construction	Timber
Roof covering	Flat Roof, Slate Pitched
PEEPs in place where necessary	No
Current Evacuation Strategy	Full (Simultaneous) Evacuation
Conversion or purpose-built	Conversion
Number of storeys	3
Number of floors on which car parking is provided	1
Is there a habitable basement?	No
Number of internal Staircases (protected or unprotected?)	1 protected
Number of External Staircases	None
External Balcony part of escape route?	No
Unusual features	Not at this property
Building Access Conditions for Fire Brigade	Vehicular Access to one or more elevations

Asset ID: 9029 **4 Spa Lane Block 1-3 Spa Lane, Harrogate**

Fire Detection and Warning System	Flats and common areas not linked
Grade of fire alarm	Grade D
Category of fire alarm	LD2 Additional Protection
Emergency Lighting Provision	Non Maintained System - Common Areas
Portable Fire Extinguishers supplied/fitted	No
Fixed Fire Fighting Installations	No

Customers

Number of occupants	3
Occupant tenure type breakdown	General Needs

Fire Safety Related Customer Safety Servicing

Overdue communal gas safety checks	0
Overdue domestic gas safety checks	0
Overdue communal electrical condition checks	0
Overdue domestic electrical condition checks	0
Overdue alarm call pull chord tests	0
Overdue communal PAT testing	0
Overdue customer mobility scooter PAT testing	0
Overdue Monthly Emergency Lighting Switch Tests	1
Overdue Annual Emergency Lighting tests	1
Overdue Weekly Fire Alarm Testing	0
Overdue Fire Panel - Six Monthly Testing	
Overdue Fire Safety Equipment tests	1

Building Fire Safety Surveys - Communal Doors

Failing Communal Fire Doors	0
Communal Fire doors due for replacement within 5 years	0

Dwelling Doors

Failing Dwelling Fire Doors	0
Dwelling Fire doors due for replacement within 5 years	0

Fire Risk Assessment Survey Results

Scheme and Building Information

Photo



Date of Fire Risk Assessment	01/08/2024
FRA Frequency (Months)	12
Purpose of Fire Risk Assessment	Annual Re-Assessment
Type of Risk Assessment	Type 1 (Common Parts Only - Non Destructive)
Quantity	1
Fire & Safety Assessor	Kevin Jones GFireE Level 4 Certification in Fire safety Fire Auditor
Enforcing Fire Authority	North Yorkshire
Scheme Tel. No	
Other staff in attendance	None
Number of on-site Accent staff	Scheme Manager Weekdays
Number of other (non-Accent) staff	
Scheme Inspection completed	Yes
Number of occupants	3
Personal Emergency Evacuation Plans in place	No
Current Evacuation Strategy	Full (Simultaneous) Evacuation
Conversion or purpose-built	Conversion
Number of Storeys	3
Number of floors on which car parking is provided	1
Is there a habitable basement?	No
No. of internal staircases (protected/unprotected)	1 protected
Number of external staircases	None
External balcony part of escape route?	No
Unusual features	Not at this property

Fire Risk Assessment Survey Results

Building access conditions for Fire Brigade	Vehicular Access to one or more elevations
Surroundings: Residential/Commercial	Mixed
Fire Detection and Warning System	Flats and common areas not linked
Grade of Fire Alarm	Grade D
Category of Fire Alarm	LD2 Additional Protection
Emergency Lighting Provision	Non Maintained System - Common Areas
Portable Fire Extinguishers / Fire Blankets supplied / fitted	No
Water Extinguisher(s) present	No
Foam Extinguisher(s) present	No
Dry Powder Extinguisher(s) present	No
Carbon Dioxide Extinguisher(s) present	No
Fire Blanket(s) present	No
Fixed Fire Fighting Installations supplied / fitted	No
Dry Riser(s) present	No
Wet Riser(s) present	No
Sprinkler System present	No
Hosereel(s) present	No
Automatic Opening Vent(s) present	Yes

Electrical Sources of Ignition

Electrical installation within common areas in good condition and no obvious damage?	Yes
Comment	Appears to be in good condition and secured
Valid Electrical Installation Condition Reports held on file? (Common Areas & General Needs Flats)	Yes
Comment	Results are uploaded to Active H
Electrical App/PA Testing - tested within past 12 months?	N/A
Comment	No portable appliance evident in communal areas identified
Absence of trailing leads and adapters?	N/A
Comment	No portable appliance evident in communal areas
Evidence that mobility scooters are not being stored/charged in common areas?	Yes
Comment	None identified during inspection
Is there a purpose built mobility scooter store/charging area?	No

Asset ID: 9029 **4 Spa Lane Block 1-3 Spa Lane, Harrogate**

Comment

Does the building have a lightning protection system?

No

Comment

Not required for the height of the building

Gas installations

Is there a commercial/domestic gas supply to the scheme?

Yes

Comment

Domestic gas supply

Valid LGSR held on file for fixed communal area gas appliances?
(Boilers)

N/A

Comment

No communal gas appliances in premis

Valid LGSR held on file for residential flats that contains gas appliances?

Yes

Comment

Results are uploaded to Active H

Are smoke/heat detectors within General Needs flats subject to an annual inspection and the results

Yes

Comment

Results are uploaded to Active H

Other Sources of Ignition

Is there a no smoking policy in place, which is enforced and adhered to?

Yes

Comment

communal areas only

Adequate security against arson?

Yes

Comment

Night latch fitted to front entrance and rear door within flat number 1

Are refuse/recycling bin areas managed and suitably located?

Yes

Comment

Stored to the rear garden of property

Are there communal cooking facilities at this scheme?

No

Comment

Housekeeping

Are all electrical/intake/service cupboards secure and free from general waste, contractors waste and residents personal items?

Yes

Comment

Appears to be in good condition and secured

Are unnecessary accumulations of combustible materials or waste avoided?

Yes

Comment

Sterile communal areas identified during inspection

Are combustible materials and substances separated from ignition sources and stored appropriately?

Yes

Asset ID: 9029

4 Spa Lane Block 1-3 Spa Lane, Harrogate

Comment

Sterile environment observed during inspection

Furniture/furnishings in good condition, fire retardant/resistant and comply with modern standards and regulations?

N/A

Comment

None provided in premis

Other Significant Fire Hazards

Are all other significant fire hazards adequately controlled?

Yes

Comment

Good houskeeping observed during inspection

Means of Escape from Fire

Is it considered that the building is provided with reasonable means of escape in case of fire?

Yes

Comment

Single direction MOE and single stair case

Escape routes unobstructed and safe to use?

Yes

Comment

Clear corridors and stair case

Exits immediately openable without a key and/or failsafe's function correctly?

Yes

Comment

Reasonable distances of travel where there is a single/alternative direction of travel?

Yes

Comment

Minimal travel distances

Escape routes lead to final exits and open in direction of escape where necessary?

Yes

Comment

Single direction from 1st and 2 nd floor flats two directional from ground floor flat

Observation	Priority	Referred To	Required By:	Task ID
AOV inoperable requires emergency repair	Internal - High	Project Manager (Building Safety)	02/08/2024	1848419

Fire Spread and Development

Is it considered that the compartmentation is of a reasonable standard?

Yes

Comment

Traditional construction of brick and mortar and plaster finish

Is there reasonable limitation of surface finishes that might promote fire spread (walls, floors, ceilings)?

Yes

Comment

Plaster finish to walls and ceiling

Are fire dampers/shutters provided in ducts/refuse chutes to protect means of escape against fire, smoke and combustion products?

N/A

Comment

None evident in communal areas

Asset ID: 9029

4 Spa Lane Block 1-3 Spa Lane, Harrogate

As far as can be reasonably ascertained, is the compartmentation within roof spaces of a satisfactory standard?

N/A

Comment

Unable to confirm no access to flat with loft access

Loft hatches fire resisting?

N/A

Comment

Unable to confirm

As far as can be reasonably ascertained, is the fire stopping above cross corridor fire doors within suspended ceiling void of a satisfactory standard?

N/A

Comment

No cross corridor doors in premis

Do external walls, doors, windows and anything attached to the exterior, limit fire spread?

No

Comment

Traditional construction of brick and mortar

If Smoke Control Systems (AOV's) are fitted, are the records of annual testing available?

Yes

Comment

Uploaded to Active H

Are roller shutter doors that are required to be FR, fire resisting and self-closing?

N/A

Comment

None fitted in y

Observation	Priority	Referred To	Required By:	Task ID
def in tesr yard rewuires removing HP informed	Internal - Medium	Housing Partner	05/09/2024	1848420



Emergency Escape Lighting

Is the emergency lighting correctly specified and installed as per current standards?

Yes

Comment

Appears to be installed to correct standard

Emergency lighting units in good condition and securely fixed to walls/ceilings?

Yes

Comment

Appears to be in good condition and secured

Records of monthly/annual testing available?

Yes


Comment

Results are uploaded to Active H

Observation **Priority** **Referred To** **Required By:** **Task ID**

Lighting in good condition and secured

No Action

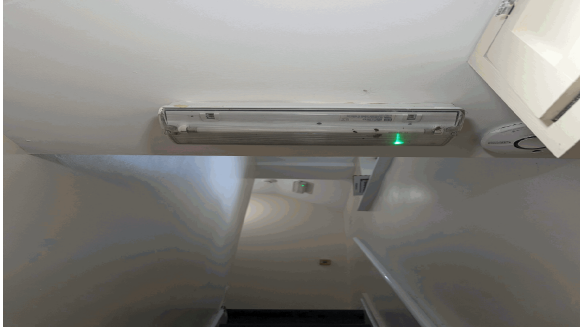

Fire Safety Signs and Notices

Are the correct Fire Action/Advice notices displayed in prominent locations within the common areas?

Yes

Comment

Fire evacuation notices evident

Directional fire escape signage in place and adequate?

N/A

Comment

Not required for single stair and direction MOE

Is there suitable LIFT signage i.e. do not use in case of fire?

N/A

Comment

None fitted in premis

Do common area fire doors display the correct signage on both sides where applicable?

Yes

Comment

Electrical intake cupboard door

Observation **Priority** **Referred To** **Required By:** **Task ID**

Correct signage throughout premis

No Action



Means of giving Warning in case of Fire

Is the scheme fitted with a communal area fire alarm?

Yes

Comment

Is fire detection and warning system appropriate for occupancy and fire risk, as per BS 5839-1:2017?

Yes

Asset ID: 9029

4 Spa Lane Block 1-3 Spa Lane, Harrogate

Comment

Is the fire detection and warning system maintained/tested and all certificates saved on file?

Yes

Comment

Results are uploaded to Active H

Fire alarm components in good condition and securely fixed to walls/ceilings?

Yes

Comment

Appears to be in good condition and secured

Hold open devices operate at the sounding of the alarm and are in a serviceable condition?

N/A

Comment

None fitted in premis

Are there heat detectors located in the Kitchen, Boiler, Plant Room and Laundry?

N/A

Comment

No rooms in premis

Is the fire alarm panel remotely monitored, and if so are there records of regular testing?

No

Comment

Not remotely monitored

Fire Extinguishing Equipment

Is fire extinguishing equipment and/or fixed fire fighting installations provided at this scheme?

No

Comment

Management of Fire Safety

Are these premises regulated by the Building Safety Regulator under the Building Safety Act?

No

Comment

Are there other Responsible Persons who share or have fire safety duties in respect of the premises?

No

How will this sharing be achieved?

Is an office or IL scheme being inspected?

No

Comment

Passenger Lift

Is the scheme fitted with a passenger lift?

No

Comment

Premises Inspection Box

Is there a premises information box for fire & rescue service use?

No

Comment

Evacuation Policy

Are there suitable arrangements for summoning the fire service?

Yes

Comment

999 call from residence

Taking FRA findings, is the evacuation policy appropriate for the scheme as per latest guidance?

Yes

Comment

Converted flats

Engagement with Residents

Has information of fire procedures been disseminated to residents?

Yes

Comment

evacuation notice in communal areas

Is general fire safety information disseminated to residents?

Yes

Comment

Customer portal and induction programme

FRA Frequency

Taking the findings of this assessment into account, is the frequency of the FRA correct?

Yes

Comment

converttrf flays with transient customers

Miscellaneous

Are there any other observations/actions to raise that are not covered above.

Yes

Action leading to a repair

Yes

Internal administrative Action

Yes

Are there fire related remedial works required at this property, that will affect the fabric of the building?

Yes

Comment

AOV inoperative emergency repair requested on repairs portal work order no. 1203281

Can work be conducted without the need for an asbestos survey. If no, task Customer Safety Surveyor - Asbestos.

Yes

Comment

Were there any unsatisfactory aspects of the Fire Risk Assessment? (Visible on Building Safety Report).

Yes

Some fire doors did not fully close so works orders have been raised with our contractors.

No

Some minor works were required which have been raised with our contractors.

Yes

Asset ID: 9029

4 Spa Lane Block 1-3 Spa Lane, Harrogate

Unauthorised items were found in communal areas and arrangements were made for their removal. Yes

Not all records were up to date, as noted in the table below. Arrangements have been made for these to be completed. No

A number of fire doors were found to be wedged or propped open. Fire doors are there to keep you safe and me kept shut at all times. No

Risk Calculator - Fire

The following risk estimator is based on the general health and safety risk level estimator contained within BS 8800: 1996. Guide to occupational health and safety management systems.

1. Taking into account the fire prevention measures observed at the time of this risk assessment, it is considered that the hazard from the fire (the probability of ignition) at this building is:

LOW MEDIUM HIGH

2. Taking into account the nature of the building, the occupants, the fire protection afforded and any procedural arrangements observed at the time of the assessment, it is considered that the consequences for life safety in the event of a fire would be:

MINOR MAJOR CRITICAL

The definition of the above terms is as follows:

FRA Review Frequency

MINOR	Outbreak of fire is unlikely to result in serious injury or death of any occupant (other than the occupant sleeping in a bedroom in which a fire occurs).
MAJOR	An outbreak of fire could result in injury of one or more occupants, but is unlikely to lead to fatalities.
CRITICAL	There is significant potential for serious injury or death of one or more occupants.

3. The above estimates are then read into the following matrix table to give the overall risk level for the site:

Fire Hazard	Minor	Major	Critical
Low	Trivial	Tolerable	Moderate
Medium	Tolerable	Moderate	Substantial
High	Moderate	Substantial	Intolerable

When the level of risk is established, the action level can be read from the table below:

Risk Level	Guide to actions and appropriate timescales
Trivial	No action is required
Moderate	Efforts should be made to reduce the risk level and this should be carried out within the specified time periods.
Substantial	Considerable resources may have to be allocated to reduce the risk level. It may be necessary to limit the occupation of some parts until urgent remedial action is taken.
Intolerable	The building (or the relevant area) should not be occupied until the risk is reduced.

The Overall Risk Level for this asset is: **Trivial**