

ACCENT HOUSING - FIRE RISK ASSESSMENT



Region :	South
Scheme Name :	Green Lane
Scheme Address :	28-42 Green Lane. Bagshot, Surrey GU19 5NL
Date of Assessment:	27/04/2022
Date of Next Assessment:	27/04/2025
FRA Frequency:	3 Year Re-Assessment
Fire & Safety Assessor	Gary Bredin

This Fire Risk Assessment has been conducted upon the instruction of Accent Housing.

Scheme Details		Green Lane
Region:		South
Scheme Name:		Green Lane
Site Address:	Street:	28-42 Green Lane.
	Town:	Bagshot, Surrey
	Post Code:	GU19 5NL
Block & Asset No.		Block 28-34 Asset No.25122
Block & Asset No.		Block 36-42 Asset No.25123
Scheme Tel. No:		
Date of this Assessment		27/04/2022
Date of Next Review		27/04/2025
Fire Risk Assessment Frequency		3 Years
Health & Safety Assessment Frequency	/	
Purpose of Fire Risk Assessment		3 Year Re-Assessment
Fire & Safety Assessor		Gary Bredin
Director of Customer Experience		Rob Mills
Customer Partnership Manager		Matt Cobb
Contract Manager		Lin Parmer
Scheme Manager/Customer Partner		Ammarah Hasan
Other staff in attendance		
Use of Building		General Needs
Approximate Number of occupants		20+
Occupancy Profile		Families
Familiarity of the occupants		Slightly Familiar
Likely state of the Occupants		Alert
PEEPs in place where necessary		N/A
Number of on-site Accent staff		None
Number of other (non-Accent) staff		Contract cleaners
Support Agency (Supported Housing)		N/A
Current Evacuation Strategy.		Stay Put (Delayed) Evacuation
Evidence that residents have been noti	fied of the	Advice signage displayed in
evacuation procedure		common areas
History of fires in the building		None
Business Continuity Plan in place?		Yes
		Type 3 (Common Parts & Flats -
Scope of Assessment		Non Destructive)
		Sleeping Accommodation Guide
Applicable Fire Safety Guidance		
		Purpose-built flats guide

Building Details	Green Lane
Construction Date	1967
	Joisted or Load Bearing Masonry
Construction Type	(Traditional)
Roof Finish	Pitched-Slate Tile
External Wall Finish	Brick
Are there any areas of external wall cladding	No
Are there any balconies	No
Conversion or purpose-built	Purpose Built
Number of flats (self-contained)/rooms (HMOS, shared	Eight self contained flats
houses)	
Number of storeys above ground	Тwo
Number of storeys below ground	None
Is there a habitable basement?	N/A
Number of internal Staircases per Block	
(protected or unprotected?)	One-Protected
Number of External Staircases per Block	None
External Balcony part of escape route?	No
Unusual features	None
Building complexity	Simple
Building Access Conditions for Fire Brigade	Vehicular Access to one or more
	elevations
Surroundings: Residential/Commercial	Residential
Fire Provision Currently in P	
Fire Detection and Warning System	Flats only
Grade of fire alarm	Grade D
Category of fire alarm	LD3 Minimum Protection
Additional Comments:	None
	Non Maintained System -
Evacuation Alert System (EAS)	Common Areas
Additional Comments:	
Emorgonov Lighting Provision	Non Maintained System -
Emergency Lighting Provision Additional Comments:	Common Areas
Portable Fire Extinguishers	None fitted
Additional Comments:	
Fixed Fire Fighting Installations	None fitted
Additional Comments:	

	Significant Findings - Fire						
	Gree	n L	ane		27/04/2022		
Action Ref:	Potential Area of Fire Risk	Yes-No-N/A	Observation/Comments/ Actions Required	Risk Rating	Target Completion Date	Referred To:	
			Fire Hazards				
1	Electrical Sources of Ignition:				-		
1.1	Electrical Installation within common areas (Fixed Wiring, sockets, switches, light fittings) in good condition and no obvious damage	Yes	All common area sockets and fittings in a satisfactory condition at the time of inspection.	•			
1.2	Valid Electrical Installation Condition Reports held on file.(Common Areas)	Yes	Commission an electrical safety inspection completed and uploaded to the property file.				
1.3	Valid Electrical Installation Condition Reports held on file. (General Needs Flats)	Yes		•			
1.4	Electrical App/PA Testing - all portable appliances tested within past 12 months	N/A	PAT not required, no portable electrical equipment in communal areas				
1.5	Absence of trailing leads and adapters	Yes		•			
1.6	Mobility Scooters - Stored/charged in common areas, purpose built store/resident flat	Other	No evidence of any Mobility Scooters being stored or charged on this site at the time of this inspection.	-			
2	Smoking:						
2.1	Are there any risks associated with smoking in the building?	No	No smoking policy within common areas				
3	Arson:						
3.1	Adequate security against arson?	Yes	Building secure - Intercom door entry system with trade button access.	•			
3.2	Is there an absence of unnecessary fire load in close proximity to building?	Yes	All external common areas clear at time of inspection				

4	Heating Installations (Portable/fixed)				
	Gas Installations - Common Areas & Gener	al Ne	eds Residential flats.		
4.1	If portable heaters are used, are there suitable controls?	N/A	No portable heaters permitted in communal areas		
4.2	Are fixed heating installations subject to regular maintenance?	Yes 1		•	
4.3	Valid LGSC held on file for each residential flat that contains gas appliances.	Yes			
5	Cooking:				
5.1	Are reasonable measures taken to prevent fires as a result of cooking?	N/A	No communal cooking areas		
5.2	Where there is extraction ventilation in communal kitchens are filters changed/ cleaned and ductwork cleaned regularly?	N/A		•	
6	Lightning Protection System:	<u>.</u>			
6.1	Does the building have a lightning protection system, If so, is it adequately maintained?	N/A	According to the lightning protections regulations (as satiated in the RC 35 'Protection of buildings against lightning strikes'), it is not a legal requirement for buildings to be fitted with lightning protection.	ı	
7	Housekeeping:		•		
7.1	Is the standard of housekeeping adequate?	Yes		·	
7.2	Are all electrical/intake/service cupboards secure and free from general waste, contractors waste and residents personal items.	Yes	All cupboards secure and clear at time of inspection	I	
7.3	Are combustible materials separated from ignition sources and stored appropriately?	Yes		I	
7.4	Are unnecessary accumulations of combustible materials or waste avoided?	Yes		•	

7.5	Are hazardous materials stored appropriately (i.e. oxygen cylinders, flammable materials, explosive products, oxidising products, aerosols)	N/A	No hazardous materials stored on site.			
8	Furniture/furnishings on escape routes and	l oth	er communal areas:	•	•	
8.1	Furniture/furnishings in good condition, fire retardant and complies with 1988 Regulations.	N/A	No furniture allowed in the common areas.	•		
9	Other Significant Fire Hazards:					
9.1	Are there other significant fire hazards that are inadequately controlled?	No		•		
		Fire	Protection Measures			
10	Means of Escape from Fire:					
10.1	Is it considered that the building is provided with reasonable means of escape in case of fire?	Yes	Final exit doors in all flats on the means of escape are FD30s and conforming to the latest British Standard.			
10.2	Escape routes unobstructed and safe to use?	Yes	Final exit door open inwards. Acceptable risk as only four flats per block.	•		
10.3	Exits easily and immediately openable where necessary, without a key?	Yes	All exit doors are of the push bar, push pad or thumb turn type	•		
10.4	Reasonable distances of travel where there is a single/alternative direction of travel?	Yes	All escape routes are within permissible distances some extra signage installed during inspection by	•		
10.5	Escape routes lead to final exits and open in direction of escape where necessary?	Yes		•		
10.6	Do failsafe's on locked exit doors function correctly?	Yes	Some needed minor attention (completed during the inspection) by the Assessor.	•		
	Is it considered that the building is provided with reasonable arrangements for means of escape for disabled people?	No	Ground floor areas only are suitable for disabled access/egress.	•		
	Measures to Limit Fire Spread and Develop	men	t:			
11.1	Is it considered that the compartmentation is of a reasonable standard?	Yes		•		

11.1 Compartmentation within roof spaces of a satisfactory standard? 11.3 Are free dampers/shutters provided in ducts/refuse chutes to protect means of escape against fire, smoke and combustion products? 11.4 Compartmentation within roof spaces of a satisfactory standard? 11.4 No access from common areas 1 11.5 Loft hatches fire resisting? 10 No loft hatches in common areas 1 11.6 Fire stopping above cross-corridor fire doors within suspended ceiling void of a satisfactory standard 11.7 11.7 Sonke Control Systems (AOV's) Are records of annual testing available? 11.7 11.7 Bolte external walls, windows, balconies etc pose a risk of significant fire spread? 0 0 11.8 Communal Area Fire Doors (Inspection to include - construction, hinges, closure devices, intumescent/smoke seal condition, glazing systems and maximum gaps between or and frame. 1 12.2 "Fire door keep shul/locked" signage displayed on both sides of all applicable doors. 1 2 12.3 Hold open devices operate at the sounding of the alarm and are in a serviceable condition. 2 2 1 12.3 Hold open devices operate at the sounding of the alarm and are in a serviceable condition. 2 2 2 1 12.4 Firet door keep shul/locked" signage displayed on both sides	112	Is there reasonable limitation of surface					1
Infoors, cellings)? Image: Construction of the adapter system of escape against fire, smoke and combustion products? Image: Construction of the adapter system of escape against fire, smoke and combustion products? 11.4 Compartmentation within roof spaces of a satisfactory standard? Image: Construction of the adapter system of escape against fire, smoke and combustion products? No access from common areas Image: Construction of the adapter system of escape against fire, smoke and combustion products? 11.4 Compartmentation within roof spaces of a satisfactory standard? No loft hatches in common areas Image: Construction of the adopter system of escape against fire, smoke and combustion products? 11.5 Loft hatches fire resisting? Image: Construction of fire doors within suspended celling void of a satisfactory standard Image: Construction of fire coors within suspended celling void of a satisfactory standard Image: Construction of fire resisting Image: Construction of fire fore systems down of fire resisting Image: Construction of fire fore systems down of fire fore system sign and maximum gaps between toor and frame. Image: Construction of fire doors were found to be in good condition and conforming to the latest British in a serviceable condition, in a serviceable condition, in a serviceable condition, in a serviceable condition, in a serviceable condition of the alarest British in a serviceable condition of the alarest and are in a serviceable condition of the alarest British in a servicea			es				
11.3 Are fire dampers/shutters provided in ducts/refuse chutes to protect means of escape against fire, smoke and combustion products? Image: Compartmentation within roof spaces of a satisfactory standard? Image: Compartmentation within roof spaces of a satisfactory standard? Image: Compartmentation within roof spaces of a satisfactory standard? Image: Compartmentation within roof spaces of a satisfactory standard? Image: Compartmentation within roof spaces of a satisfactory standard? Image: Compartmentation within roof spaces of a satisfactory standard? Image: Compartmentation within suspended ceiling void of a satisfactory standard Image: Compartmentation within suspended ceiling void of a satisfactory standard Image: Compartmentation within suspended ceiling void of a satisfactory standard Image: Compartmentation within suspended ceiling void of a satisfactory standard Image: Compartmentation within suspended ceiling void of a satisfactory standard Image: Compartmentation within suspended ceiling void of a satisfactory standard Image: Compartmentation within suspended ceiling void of a satisfactory standard Image: Compartmentation within suspended ceiling void of a satisfactory standard Image: Compartmentation within suspended ceiling void of a satisfactory standard Image: Compartmentation within suspended ceiling void of a satisfactory standard Image: Compartmentation within suspended ceiling void of a satisfactory standard Image: Compartmentation within suspended ceiling void of a satisfactory standard Image: Compartmentation within suspended ceiling void of a satisfactory standard Image: Compartmentati suspended ceiling void of a satisfactory standard <td< td=""><td></td><td></td><td>×</td><td></td><td></td><td></td><td></td></td<>			×				
ducts/refuse chutes to protect means of escape against fire, smoke and combustion products? Y Image: Smoke and combustion products? 11.4 Compartmentation within roof spaces of a satisfactory standard? Smoke against fire, smoke and combustion products? No loccess from common areas Image: Smoke against fire, smoke and combustion products? 11.5 Loft hatches fire resisting? Smoke and combustion areas Image: Smoke against fire, smoke and combustion products? Image: Smoke against fire, smoke agains	11.3	• •					
escape against fire, smoke and combustion products? 2 No access from common areas 1 1 11.4 Compartmentation within roof spaces of a satisfactory standard? 80 No access from common areas 1 1 11.5 Loft hatches fire resisting? 80 No loft hatches in common areas 1 1 11.6 Fire stopping above cross-corridor fire doors within suspended ceiling void of a satisfactory standard VI 1			⊲				
products?Products?			Ž		•		
satisfactory standard?511.5Loft hatches fire resisting?9No loft hatches in common areas1Image: Common areas111.6Fire stopping above cross-corridor fire doors within suspended ceiling void of a satisfactory standard21mage: Common areas1mage: Common areas1							
satisfactory standard?511.5Loft hatches fire resisting?9No loft hatches in common areas1Image: Common areas111.6Fire stopping above cross-corridor fire doors within suspended ceiling void of a satisfactory standard21mage: Common areas1mage: Common areas1	11.4	Compartmentation within roof spaces of a	er	No access from common areas			
11.5 Loft hatches fire resisting? 9 No loft hatches in common areas . Image: common areas . <t< td=""><td></td><td></td><td>Oth</td><td></td><td>•</td><td></td><td></td></t<>			Oth		•		
InterpretationImage: construction of a satisfactory standardImage: construction of a sa	11.5	Loft hatches fire resisting?		No loft hatches in common areas			
fire doors within suspended ceiling void of a satisfactory standard Y2 Image: Control Systems (AOV's) Are records of annual testing available? Y2 11.7 Smoke Control Systems (AOV's) Are records of annual testing available? Y2 Image: Control Systems (AOV's) Are records of annual testing available? Y2 11.8 Roller shutter doors (fire resisting) Y2 Y2 Image: Control Systems (AOV's) Are records of annual testing available? Y2 11.8 Roller shutter doors (fire resisting) Y2 Y2 Image: Control Systems (AOV's) Are records of annual testing available? Y2 Image: Control Systems (AOV's) Are records of annual testing available? Y2 Image: Control Systems (AOV's) Are records of annual testing available? Y2 Image: Control Systems (AOV's) Are records of annual testing available? Y2 Image: Control Systems (AOV's) Are records of annual testing available? Y2 Image: Control Systems (AOV's) Are records of annual testing available? Y2 Image: Control Systems (AOV's) Are records of annual testing available? Y2 Image: Control Systems (AOV's) Are records of annual testing available? Y2 Image: Control Systems (AOV's) Are records of annual testing available? Y2 Image: Control Systems and maximum gaps between our and frame. Image: Control Systems and maximum gaps between our and frame. Image: Control Systems and maximum gaps between our and frame. Image: Control System			У		Ľ		
satisfactory standard Image: Satisfactory standard <t< td=""><td>11.6</td><td></td><td>4</td><td></td><td></td><td></td><td></td></t<>	11.6		4				
satisfactory standard Image: Satisfactory standard <t< td=""><td></td><td></td><td>Ž</td><td></td><td>•</td><td></td><td></td></t<>			Ž		•		
Are records of annual testing available? Ž Image: Construction of the alarm and are in a serviceable condition of the alarm and are in a serviceable condition V Image: Construction of the alarm and are in a serviceable condition 11.3 Poil of the entrance doors (Internal Common Areas: V V V V 11.8 Roller shutter doors (Internal Common Areas: V V V V V 11.9 Do the external walls, windows, balconies etc pose a risk of significant fire spread? V							
11.8 Roller shutter doors (fire resisting) V V Image: State of St		• • •	¥				
11.9 Do the external walls, windows, balconies etc pose a risk of significant fire spread? 2 -		Are records of annual testing available?	N		_		
pose a risk of significant fire spread?Ž12Communal Area Fire Doors (Inspection to include - construction, hinges, closure devices, intumescent/smoke seal condition, glazing systems and maximum gaps between or and frame.12.1Communal fire doors to FD30s standard and in a serviceable condition,All communal fire doors were found to be in good condition and conforming to the latest British standard.Image: serviceable condition in the serviceable condition and conforming to the latest British standard.12.2"Fire door keep shut/locked" signage displayed on both sides of all applicable doors.Image: serviceable condition12.3Hold open devices operate at the sounding of the alarm and are in a serviceable conditionImage: serviceable condition13.1Do flat entrance doors open onto internal escape routes?Image: serviceable condition13.1Do flat entrance doors open onto internal escape routes?Image: serviceable condition	11.8	Roller shutter doors (fire resisting)	N/A		•		
Dose a risk of significant file spread? Image: Communal Area Fire Doors (Inspection to include - construction, hinges, closure devices, intumescent/smoke seal condition, glazing systems and maximum gaps between or and frame. 12.1 Communal fire doors to FD30s standard and in a serviceable condition, All communal fire doors were found to be in good condition and conforming to the latest British Standard. Image: Communal Area Fire Doors (Internal Common Areas) 12.2 "Fire door keep shut/locked" signage displayed on both sides of all applicable doors. Some signs were missing and were replaced/updated during the inspection. Image: Common area in a serviceable condition	11.9	Do the external walls, windows, balconies etc	0				
glazing systems and maximum gaps between door and frame. 12.1 Communal fire doors to FD30s standard and in a serviceable condition, Image: Communal fire doors were found to be in good condition and conforming to the latest British Standard. Image: Communal fire doors were found to be in good condition and conforming to the latest British Standard. Image: Communal fire doors were found to be in good condition and conforming to the latest British Standard. Image: Communal fire door keep shut/locked" signage displayed on both sides of all applicable doors. Image: Communal fire doors were missing and were replaced/updated during the inspection. Image: Communal fire doors were missing and were replaced/updated during the inspection. Image: Communal fire doors were missing and were replaced/updated during the inspection. Image: Communal fire doors were missing and were replaced/updated during the inspection. Image: Communal fire doors were missing and were replaced/updated during the inspection. Image: Communal fire doors were missing and were replaced/updated during the inspection. Image: Communal fire doors were missing and were replaced/updated during the inspection. Image: Communal fire doors were missing and were replaced/updated during the inspection. Image: Communal fire doors were missing and were replaced/updated during the inspection. Image: Communal fire doors were missing and were replaced/updated during the inspection. Image: Communal fire doors were missing and were replaced/updated during the inspection. Image: Communal fire doors were missing and were replaced/updated during the inspection. Image: Communal fire doors were missing and were replaced/updated during the inspec		pose a risk of significant fire spread?	Z		•		
12.1 Communal fire doors to FD30s standard and in a serviceable condition, All communal fire doors were found to be in good condition and conforming to the latest British • 12.2 "Fire door keep shut/locked" signage displayed on both sides of all applicable doors. Some signs were missing and were replaced/updated during the inspection. • 12.3 Hold open devices operate at the sounding of the alarm and are in a serviceable condition ✓ ✓ 13.1 Do flat entrance doors open onto internal escape routes? ✓ If yes, see "Residents Front Doors Sheet" •	12	Communal Area Fire Doors (Inspection to i	nclue	de - construction, hinges, closure devices, intum	esce	nt/smoke s	eal condition,
in a serviceable condition,Image: Condition and conforming to the latest British Standard.Image: Condition and conforming to the latest British Standard.12.2"Fire door keep shut/locked" signage displayed on both sides of all applicable doors.Image: Condition and conforming to the latest British standard.Image: Condition and conforming to the latest British Standard.12.3Hold open devices operate at the sounding of the alarm and are in a serviceable conditionImage: Condition and conforming to the latest British standard.Image: Condition and conforming to the latest British Standard.13.1Do flat entrance doors (Internal Common Areas:Image: Condition and conforming to the latest British standard.Image: Condition and conforming to the latest British Standard.13.1Do flat entrance doors open onto internal escape routes?Image: Condition and conforming to the latest British Standard.Image: Condition and conforming to the latest British Standard.13.1Do flat entrance doors open onto internal escape routes?Image: Condition and conforming to the latest British Standard.Image: Condition and conforming to the latest British Standard.		glazing systems and maximum gaps betwe	en d	oor and frame.			
Image: Standard.Image: Standard.Image: Standard.12.2"Fire door keep shut/locked" signage displayed on both sides of all applicable doors.Image: Some signs were missing and were replaced/updated during the inspection.Image: Some signs were missing and were replaced/updated during the inspection.Image: Some signs were missing and were replaced/updated during the inspection.Image: Some signs were missing and were replaced/updated during the inspection.Image: Some signs were missing and were replaced/updated during the inspection.Image: Some signs were missing and were replaced/updated during the inspection.Image: Some signs were missing and were replaced/updated during the inspection.Image: Some signs were missing and were replaced/updated during the inspection.Image: Some signs were missing and were replaced/updated during the inspection.Image: Some signs were missing and were replaced/updated during the inspection.Image: Some signs were replaced/updated during the inspection.Image: Some	12.1	Communal fire doors to FD30s standard and		All communal fire doors were found to be in good			
Image: Standard.Image: Standard.Image: Standard.12.2"Fire door keep shut/locked" signage displayed on both sides of all applicable doors.Image: Some signs were missing and were replaced/updated during the inspection.Image: Some signs were missing and were replaced/updated during the inspection.Image: Some signs were missing and were replaced/updated during the inspection.Image: Some signs were missing and were replaced/updated during the inspection.Image: Some signs were missing and were replaced/updated during the inspection.Image: Some signs were missing and were replaced/updated during the inspection.Image: Some signs were missing and were replaced/updated during the inspection.Image: Some signs were missing and were replaced/updated during the inspection.Image: Some signs were missing and were replaced/updated during the inspection.Image: Some signs were missing and were replaced/updated during the inspection.Image: Some signs were replaced/updated during the inspection.Image: Some		in a serviceable condition,	les	condition and conforming to the latest British	•		
displayed on both sides of all applicable doors. image: construction of the sides of all applicable doors. image: construction of the sides of all applicable doors. 12.3 Hold open devices operate at the sounding of the alarm and are in a serviceable condition image: construction of the alarm and are in a serviceable condition image: construction of the alarm and are in a serviceable condition image: construction of the alarm and are in a serviceable condition image: construction of the alarm and are in a serviceable condition image: construction of the alarm and are in a serviceable condition image: construction of the alarm and are in a serviceable condition image: construction of the alarm and are in a serviceable condition image: construction of the alarm and are in a serviceable condition image: construction of the alarm and are in a serviceable condition image: construction of the alarm and are in a serviceable condition image: construction of the alarm and are in a serviceable condition image: construction of the alarm and are in a serviceable condition image: construction of the alarm and are in a serviceable condition image: construction of the alarm and are in a serviceable condition image: construction of the alarm and are in a serviceable condition image: construction of the alarm and are in a serviceable condition image: construction of the alarm and are in a serviceable condition image: construction of the alarm and are in a serviceable condition image: construction of the alarm and are in a serviceable condition image: construction of the alarm and are in a serviceable condition i				Standard.			
doors.doors.dododo12.3Hold open devices operate at the sounding of the alarm and are in a serviceable conditionImage: Condition </td <td>12.2</td> <td>"Fire door keep shut/locked" signage</td> <td>(0)</td> <td>Some signs were missing and were</td> <td></td> <td></td> <td></td>	12.2	"Fire door keep shut/locked" signage	(0)	Some signs were missing and were			
doors.doors.dododo12.3Hold open devices operate at the sounding of the alarm and are in a serviceable conditionImage: Condition </td <td></td> <td>displayed on both sides of all applicable</td> <td>les</td> <td>replaced/updated during the inspection.</td> <td>•</td> <td></td> <td></td>		displayed on both sides of all applicable	les	replaced/updated during the inspection.	•		
the alarm and are in a serviceable condition Image: Conditin Image: Condition Imag		doors.					
Image: Note and the second state of the second state o	12.3	Hold open devices operate at the sounding of					
Image: Note and the second state of the second state o		the alarm and are in a serviceable condition	N		•		
13.1 Do flat entrance doors open onto internal escape routes?							
escape routes?	13	Flat entrance doors (Internal Common Area	is)				
	13.1	· ·	e S	If yes, see "Residents Front Doors Sheet"			
14 Flats with a single direction of escape to a single escape stairway. (External Balcony)			· ·				
	14	Flats with a single direction of escape to a	sing	le escape stairway. (External Balcony)			

14.1	Do the flat entrance doors that open onto an external balcony have to be passed during an escape?	N/A	If yes, see "Residents Front Doors Sheet"	•	
14.2	Are the separating walls between the flats and the balcony floor that have to be passed during an escape, fire-resisting up to a height of 1.1m?	N/A		•	
15	Emergency Escape Lighting:				
15.1	Is the emergency lighting correctly specified and installed as per BS 5266-1:2016	Yes	Non-maintained emergency lighting is installed within all escape routes	•	
15.2	Are all emergency lighting units in good condition and securely fixed to walls/ceilings	Yes	All emergency lights fixed to the ceiling and walls.	•	
15.9	Are records of monthly testing available?	Yes	Annual test certs uploaded to P Drive		
15.10	Are records of annual testing available?	Yes	Annual test certs uploaded to P Drive - Maintenance program in place	•	
16	Fire Safety Signs and Notices:				
16.1	Are the correct Fire Action/Advice notices displayed in prominent locations within the common areas?	Yes	Signage checked and updated during inspection	•	
16.3	Directional fire escape signage in place and adequate?	Yes	Signage checked and updated during inspection	•	
16.4	Is there a suitable LIFT sign i.e. do not use in case of fire.	N/A		•	
17	Means of giving Warning in case of Fire:				
	Is the fire detection and warning system appropriate for the occupancy and fire risk?	Yes	All flats have smoke detection to LD3 standard. An additional heat detector is located in the flats.	•	
17.2	Is the fire detection and warning system correctly specified and installed as per BS 5839-1:2017	N/A		•	

17.3	Is the fire detection and warning system]
	maintained/tested and all certificates saved on file. (BS 5839-1:2017)	N/A		-	
17.4	Are there heat detectors located in the Kitchen, Boiler, Plant Room and Laundry?	N/A			
17.5	Is the fire alarm panel remotely monitored, and if so are there records of regular testing?	N/A		ı	
17.6	Are smoke/heat detectors within General Needs flats subject to an annual inspection and the results recorded on an in date Landlord Gas Safety Record (LGSR)	Yes	A contract is in place with Tunstall to annually test the detection within each flat.	•	
18	Fire Extinguishing Equipment:		•		•
	Portable fire extinguishers - appropriate type/number/position?	N/A	No Fire Extinguishers on site.	•	
18.2	Correct signage displayed by each fire extinguisher?	N/A		·	
18.3	Fire blanket in communal kitchen, secured to the wall, complete with signage?	N/A		•	
18.4	Hose Reels - fitted, maintained?	N/A	None fitted	•	
18.5	Dry/wet risers - Full access to all inlet/outlet boxes. All inlet/outlets secured and/or securing straps fitted to outlet valves?	N/A	None fitted	ı	
18.6	Records available of fire fighting equipment servicing within past 12 months	N/A		•	
19		N	lanagement of Fire Safety		
19.1	Are there suitable arrangements for summoning the fire service?	Yes	It is the responsibility of our customers to raise the alarm and call the Emergency Services.	•	
19.2	Do relevant staff carry out regular fire safety checks	Yes	Regular inspections are made by the Customer Partner and any works orders are raised	•	

19.3	Sheltered Schemes & Regional Offices - Are there sufficient number of qualified Fire wardens.	N/A		•		
19.4	Offices - Are there suitable arrangements for ensuring the premises are evacuated?	N/A				
19.5	Offices - Are there suitable arrangements for evacuating disabled people?	N/A				
19.6	Offices - Are there suitable arrangements for meeting the fire service on arrival and providing relevant information?	N/A		•		
19.7	Offices/IL Schemes - Is there a suitable assembly point?	N/A				
19.8	Offices - Are fire drills carried out at appropriate intervals?	N/A				
20	20 Evacuation Policy					
20.1	Taking the findings of the FRA into account, is the evacuation policy appropriate for the scheme?	Yes	Stay put (delayed) evacuation policy in operation for residents within their flats. Residents instructed to fully evacuate if they are in a communal area.	•		


Residents Front Doors								
			27/04	/2022				
Flat entrance doors to FD30s specification (Inspection to include - Door condition, construction, closure devices, intumescent/smoke seal condition, glazing systems, fire rated letterplate, door furniture and maximum gaps between door and frame/threshold.								
Flat No.	Access Asset Observation/Comments / Actions		Risk Rating	Completion Date	Referred To:			
28			Unable to gain access. External visual inspection only.Condition good.	-				
30			Unable to gain access. External visual inspection only.Condition good.	-				
32			Unable to gain access. External visual inspection only.Condition good.	-				
34			Unable to gain access. External visual inspection only.Condition good.	-				
36			Unable to gain access. External visual inspection only.Condition good.	-				
30								
36			Unable to gain access. External visual inspection only.Condition good.	-				
			Unable to gain access. External visual inspection only.Condition good. Unable to gain access. External visual inspection only.Condition good.	-				

Photographs - Fire 27/04/2022 Green Lane





Photographs - Fire						
27/04/2022	Green Lane					

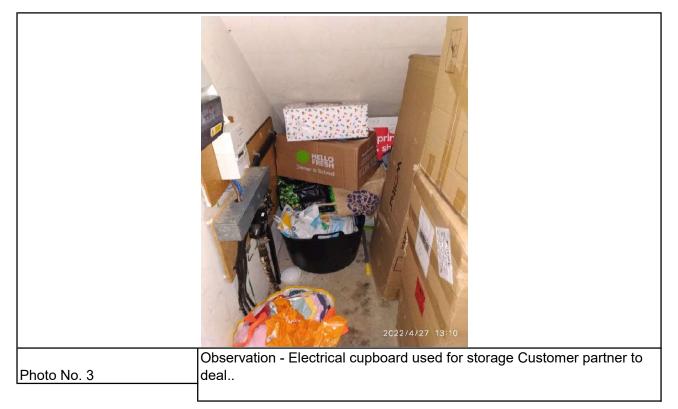



Photographs - Fire			
27/04/2022	Green Lane		
Photo No. 5	Observation- All areas clear at the time of the audit.		



07/04/0000	Photographs - Fire
27/04/2022	Green Lane
Photo No. 7	Observation: External walkways/paths aid with concrete.

I

6. Risk Calculator - Fire

The following risk estimator is based on the general health and safety risk level estimator contained within BS 8800: 1996. Guide to occupational health and safety management systems.

1. Taking into account the fire prevention measures observed at the time of this risk assessment, it is considered that the hazard from the fire (the probability of ignition) at this building is:

(please insert x below)

HIGH



2. Taking into account the nature of the building, the occupants, the fire protection afforded and any procedural arrangements observed at the time of the assessment, it is considered that the consequences for life safety in the event of a fire would be:

(please insert x below)



The definition of the above terms is as follows:

FRA Review Frequency			
MINOR	Outbreak of fire is unlikely to result in serious injury or death of any occupant		
	(other than the occupant sleeping in a bedroom in which a fire occurs).		
MAJOR	An outbreak of fire could result in injury of one or more occupants, but is unlikely		
	to lead to fatalities.		
CRITICAL	There is significant potential for serious injury or death of one or more occupants.		

3. The above estimates are then read into the following matrix table to give the overall risk level for the site:

Fire Hazard	Minor	Major	Critical
Low	Trivial	Tolerable	Moderate
Medium	Tolerable	Moderate	Substantial
High	Moderate	Substantial	Intolerable

When the level of risk is established, the action level can be read from the table below:

Risk Level	Guide to actions and appropriate timescales
Trivial	No action is required
Moderate	Efforts should be made to reduce the risk level and this should be carried out within the specified time periods.
Substantial	Considerable resources may have to be allocated to reduce the risk level. It may be necessary to limit the occupation of some parts until urgent remedial action is
Intolerable	The building (or the relevant area) should not be occupied until the risk is reduced.

Action Plan - Fire			
Green Lane	27/04/2022		
LOW			

Action Plan - Residents Front Doors						
Green Lane 27/04/2022						
Flat No.	Asset No.	Observation/Comments / Actions Required		Completion Date	Referred To:	Task ID No.
		No Actions raised.	-			