

This report shows all the responses to the Fire Risk Assessment survey, including raised tasks.

Asset ID: 24423 Horseshoe Crescent

Cover Sheet

Photo



Date of Fire Risk Assessment Date of Next Fire Risk Assessment FRA Frequency (Months) Purpose of Fire Risk Assessment Type of Fire Risk Assessment Fire & Safety Assessor 14 Jan 2025 14 Apr 2033 36 3 year Re-Assessment Type 1 (Common Parts Only - Non Destructive) Gary Bredin AlFireE

It is sensible to have arrangements in place to ensure the consistency of Fire Risk Assessments in terms of the assessment of risk and mitigations proposed. In this regard Accent peer validate around 20% of reports, which are available within our audit system.

Asset ID: 24423

Horseshoe Crescent

The Scheme

Scheme Name	Horseshoe Crescent
Scheme Address	Horseshoe Crescent
Postcode	
Region	South
Scheme Manager	
Scheme Tel. No	-
Scheme Inspection Completed	Yes
Enforcing Fire Authority	Surrey Fire and Rescue service
Other staff in attendance	None
Number of on-site Accent staff	None
Number of other (non-Accent) staff	Contract Cleaners in common areas

The Building

Accommodation Type			Gara (S30
Build Date			Jan
Number Of Homes			124
Homes breakdown			Flat,
External wall construc	tion		Facir
External wall finish			Cem Reno
Roof construction			Timb
Roof covering			Flat
PEEPs in place where	enecessary		N/A
Current Evacuation S	trategy		Stay
Conversion or purpos	e-built		Purp
Number of storeys			1, 3,
Number of floors on w	hich car parking is provided		0
Is there a habitable ba	asement?		No
Number of internal Sta	aircases (protected or unprote	cted?)	2 Un
Number of External S	taircases		None
External Balcony part	of escape route?		No
Unusual features			None
Building Access Cond	itions for Fire Brigade		Vehi
MIS-AMS ActiveH - Fire	e Risk Assessment Report	Page 2 of 14	G

rage and Car Parking Bays (S45), General Needs 0), Peerless General Needs - LSVT (S29)

1 1961

t, Garage, House

ing Brick

ment Render, Facing Brick, Hung Tiles, Paint nder, Timber Clad, UPVC Cladding ber

Roof, Interlocking Pitched

y Put (Delayed) Evacuation

pose Built

, 4

nprotected

ne

ne

nicular Access to one or more elevations

Asset ID: 24423

Horseshoe Crescent

Fire Detection and Warning System	Flats only
Grade of fire alarm	Grade D
Category of fire alarm	LD3 Minimum Protection
Emergency Lighting Provision	Non Maintained System - Common Areas
Portable Fire Extinguishers supplied/fitted	No
Fixed Fire Fighting Installations	No

Customers

Number of occupants	200
Occupant tenure type breakdown	Garage and Car Parking Bays, General Needs,
	Leasehold

Fire Safety Related Customer Safety Servicing

Overdue communal gas safety checks	0
Overdue domestic gas safety checks	0
Overdue communal electrical condition checks	0
Overdue domestic electrical condition checks	0
Overdue alarm call pull chord tests	0
Overdue communal PAT testing	0
Overdue customer mobility scooter PAT testing	0
Overdue Monthly Emergency Lighting Switch Tests	0
Overdue Annual Emergency Lighting tests	0
Overdue Weekly Fire Alarm Testing	0
Overdue Fire Panel - Six Monthly Testing	
Overdue Fire Safety Equipment tests	
Building Fire Safety Surveys - Communal Doors	
Failing Communal Fire Doors	0
Communal Fire doors due for replacement within 5 years	0

Dwelling Doors


Failing Dwelling Fire Doors	0
Dwelling Fire doors due for replacement within 5 years	0

Fire Risk Assessment Survey Results

Scheme and Building Information

Photo

Date of Fire Risk Assessment
FRA Frequency (Months)
Purpose of Fire Risk Assessment
Type of Risk Assessment
Quantity
Fire & Safety Assessor
Enforcing Fire Authority
Scheme Tel. No
Other staff in attendance
Number of on-site Accent staff
Number of other (non-Accent) staff
Scheme Inspection completed
Number of occupants
Personal Emergency Evacuation Plans in place
Current Evacuation Strategy
Conversion or purpose-built
Number of Storeys
Number of floors on which car parking is provided
Is there a habitable basement?
No. of internal staircases (protected/unprotected)
Number of external staircases
External balcony part of escape route?
Unusual features

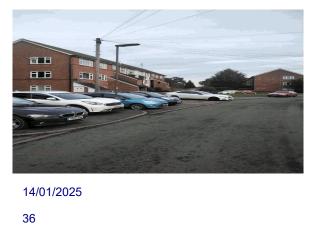

3 year Re-Assessment

Type 1 (Common Parts Only - Non Destructive)

1

Gary Bredin AlFireE

Surrey Fire and Rescue service

-

None

None

Contract Cleaners in common areas

Yes

200

N/A

Stay Put (Delayed) Evacuation

Purpose Built

3

0

No

2 Unprotected

None

No

None

Fire Risk Assessment Survey Results

Surroundings: Residential/CommercialMixedFire Detection and Warning SystemFlats onlyGrade of Fire AlarmGrade DCategory of Fire AlarmLD3 Minimum ProtectionEmergency Lighting ProvisionNon Maintained System - Common AreasPortable Fire Extinguishers / Fire Blankets supplied / fittedNoWater Extinguisher(s) presentNoForam Extinguisher(s) presentNoCarbon Dioxide Extinguisher(s) presentNoFire Blanket(s) presentNoFire Fighting Installations supplied / fittedNoOry Riser(s) presentNoSprinkler System presentNoHosereel(s) presentNoHosereel(s) presentNoAutomatic Opening Vent(s) presentNo	Building access conditions for Fire Brigade Vehicular Access to one or more elevat			
Grade of Fire AlarmGrade DCategory of Fire AlarmLD3 Minimum ProtectionEmergency Lighting ProvisionNon Maintained System - Common AreasPortable Fire Extinguishers / Fire Blankets supplied / fittedNoWater Extinguisher(s) presentNoFoam Extinguisher(s) presentNoDry Powder Extinguisher(s) presentNoCarbon Dioxide Extinguisher(s) presentNoFire Blanket(s) presentNoFire Blanket(s) presentNoFire Fighting Installations supplied / fittedNoPry Riser(s) presentNoSprinkler System present <tr< td=""><td>Surroundings: Residential/Commercial</td><td>Mixed</td></tr<>	Surroundings: Residential/Commercial	Mixed		
Category of Fire AlarmLD3 Minimum ProtectionEmergency Lighting ProvisionNon Maintained System - Common AreasPortable Fire Extinguishers / Fire Blankets supplied / fittedNoWater Extinguisher(s) presentNoFoam Extinguisher(s) presentNoDry Powder Extinguisher(s) presentNoCarbon Dioxide Extinguisher(s) presentNoFire Blanket(s) presentNoFire Blanket(s) presentNoFire Fighting Installations supplied / fittedNoPry Riser(s) presentNoSprinkler System presentNoSprinkler System presentNoSprinkler System presentNoNoNoSprinkler System presentNoNoNoSprinkler System presentNoSprinkler System presentNoNoNoSprinkler System presentNoSprinkler System PresentNo <t< td=""><td>Fire Detection and Warning System</td><td>Flats only</td></t<>	Fire Detection and Warning System	Flats only		
Emergency Lighting ProvisionNon Maintained System - Common AreasPortable Fire Extinguishers / Fire Blankets supplied / fittedNoWater Extinguisher(s) presentNoFoam Extinguisher(s) presentNoDry Powder Extinguisher(s) presentNoCarbon Dioxide Extinguisher(s) presentNoFire Blanket(s) presentNoFire Blanket(s) presentNoFire Sighting Installations supplied / fittedNoDry Riser(s) presentNoSprinkler System presentNoWet Riser(s) presentNoSprinkler System presentNoSprinkler System presentNoNoNoSprinkler System presentNoSprinkler System pre	Grade of Fire Alarm	Grade D		
Portable Fire Extinguishers / Fire Blankets supplied / fittedNoWater Extinguisher(s) presentNoFoam Extinguisher(s) presentNoDry Powder Extinguisher(s) presentNoCarbon Dioxide Extinguisher(s) presentNoFire Blanket(s) presentNoFire Blanket(s) presentNoFixed Fire Fighting Installations supplied / fittedNoDry Riser(s) presentNoWet Riser(s) presentNoSprinkler System presentNoHosereel(s) presentNo	Category of Fire Alarm	LD3 Minimum Protection		
Water Extinguisher(s) presentNoFoam Extinguisher(s) presentNoDry Powder Extinguisher(s) presentNoCarbon Dioxide Extinguisher(s) presentNoFire Blanket(s) presentNoFire Blanket(s) presentNoFixed Fire Fighting Installations supplied / fittedNoDry Riser(s) presentNoWet Riser(s) presentNoSprinkler System presentNoHosereel(s) presentNo	Emergency Lighting Provision	Non Maintained System - Common Areas		
Foam Extinguisher(s) presentNoDry Powder Extinguisher(s) presentNoCarbon Dioxide Extinguisher(s) presentNoFire Blanket(s) presentNoFixed Fire Fighting Installations supplied / fittedNoDry Riser(s) presentNoWet Riser(s) presentNoSprinkler System presentNoHosereel(s) presentNo	Portable Fire Extinguishers / Fire Blankets supplied / fitted	No		
Dry Powder Extinguisher(s) presentNoCarbon Dioxide Extinguisher(s) presentNoFire Blanket(s) presentNoFixed Fire Fighting Installations supplied / fittedNoDry Riser(s) presentNoWet Riser(s) presentNoSprinkler System presentNoHosereel(s) presentNo	Water Extinguisher(s) present	No		
Carbon Dioxide Extinguisher(s) presentNoFire Blanket(s) presentNoFixed Fire Fighting Installations supplied / fittedNoDry Riser(s) presentNoWet Riser(s) presentNoSprinkler System presentNoHosereel(s) presentNo				
Fire Blanket(s) presentNoFixed Fire Fighting Installations supplied / fittedNoDry Riser(s) presentNoWet Riser(s) presentNoSprinkler System presentNoHosereel(s) presentNo	Dry Powder Extinguisher(s) present	No		
Fixed Fire Fighting Installations supplied / fittedNoDry Riser(s) presentNoWet Riser(s) presentNoSprinkler System presentNoHosereel(s) presentNo	Carbon Dioxide Extinguisher(s) present	No		
Dry Riser(s) presentNoWet Riser(s) presentNoSprinkler System presentNoHosereel(s) presentNo	Fire Blanket(s) present	No		
Wet Riser(s) presentNoSprinkler System presentNoHosereel(s) presentNo	Fixed Fire Fighting Installations supplied / fitted	No		
Sprinkler System presentNoHosereel(s) presentNo	Dry Riser(s) present	No		
Hosereel(s) present No	Wet Riser(s) present	No		
	Sprinkler System present	No		
Automatic Opening Vent(s) present No	Hosereel(s) present	No		
	Automatic Opening Vent(s) present	No		

Electrical Sources of Ignition

Electrical installation within common areas in good condition and no obvious damage? Comment	Yes
Valid Electrical Installation Condition Reports held on file? (Common Areas & General Needs Flats)	Yes
Comment	Next test 15th July 2026
Electrical App/PA Testing - tested within past 12 months?	N/A
Comment	
Absence of trailing leads and adapters?	Yes
Comment	
Evidence that mobility scooters are not being stored/charged in common areas?	Yes
Comment	
Is there a purpose built mobility scooter store/charging area?	No

Comment

 Does the building have a lightning protection system?
 No

 Comment
 No

Gas installations

Is there a commercial/domestic gas supply to the scheme?	No
Comment	

Other Sources of Ignition

Is there a no smoking policy in place, which is enforced and adhered to?	Yes
Comment	
Adequate security against arson?	Yes
Comment	Electronic door entry system in place
Are refuse/recycling bin areas managed and suitably located?	Yes
Comment	
Are there communal cooking facilities at this scheme?	N/A
Comment	
Are reasonable measures taken to prevent fires as a result of cooking?	N/A
Comment	
Where there is extraction in communal kitchens, are filters and ductwork changed/cleaned regularly? Comment	N/A
Housekeeping	
Are all electrical/intake/service cupboards secure and free from general waste, contractors waste and and residents personal items? Comment	Yes
Are unnecessary accumulations of combustible materials or waste avoided? Comment	Yes
	NI/A
Are combustible materials and substances separated from ignition sources and stored appropriately? Comment	N/A
Furniture/furnishings in good condition, fire retardant/resistant and comply with modern standards and regulations?	N/A

Comment

Observation	Priority	Referred To	Required By:	Task ID
So items are being left in the communal areas. Housing partner dealing.				
		-		
		T		
			A D	
			Nor	

Other Significant Fire Hazards

Are all other significant fire hazards adequately controlled?		Yes		
Comment				
Observation	Priority	Referred To	Required By:	Task ID
Bin chutes were clear at the time of the audit				

Means of Escape from Fire

Is it considered that the building is provided with reasonable means of escape in case of fire? Comment	Yes
Escape routes unobstructed and safe to use?	Yes
Comment	
Exits immediately openable without a key and/or failsafe's function correctly?	Yes
Comment	
Reasonable distances of travel where there is a single/alternative direction of travel?	Yes
Comment	

Escape routes lead to final exits and open in direction of escape where necessary?

Comment

Observation	Priority	Referred To	Required By:	Task ID
All stairwells were clear at the time of the audit				

Yes



Fire Spread and Development

Is it considered that the compartmentation is of a reasonable standard?	Yes
Comment	
Is there reasonable limitation of surface finishes that might promote fire spread (walls, floors, ceilings)? Comment	Yes
Are fire dampers/shutters provided in ducts/refuse chutes to protect means of escape against fire, smoke and combustion products? Comment	N/A
As far as can be reasonably ascertained, is the compartmentation within roof spaces of a satisfactory standard? Comment	Yes
Loft hatches fire resisting?	Yes
Comment	
As far as can be reasonably ascertained, is the fire stopping above cross corridor fire doors within suspended ceiling void of a satisfactory standard? Comment	Yes
Do external walls, doors, windows and anything attached to the exterior, limit fire spread? Comment	Yes
If Smoke Control Systems (AOV's) are fitted, are the records of annual testing available? Comment	N/A
Are roller shutter doors that are required to be FR, fire resisting and self-closing?	N/A

Comment

Observation	Priority	Referred To	Required By:	Task ID

All loft hatches are of metal construction.



Emergency Escape Lighting

Is the emergency lighting correctly specified and installed as per current standards? Comment	Yes
Emergency lighting units in good condition and securely fixed to walls/ceilings? Comment	Yes
Records of monthly/annual testing available?	Yes
Comment	

Fire Safety Signs and Notices

Are the correct Fire Action/Advice notices displayed in prominent locations within the common areas?	Yes
Comment	These are posted throughout the buildings
Directional fire escape signage in place and adequate?	Yes
Comment	
Is there suitable LIFT signage i.e. do not use in case of fire?	N/A
Comment	
Do common area fire doors display the correct signage on both sides where applicable?	Yes
Comment	
Means of giving Warning in case of Fire	
Is the scheme fitted with a communal area fire alarm?	No

Comment

Fire Extinguishing Equipment

Is fire extinguishing equipment and/or fixed fire fighting installations provided at this scheme?	No
Comment	
Management of Fire Safety	
Are these premises regulated by the Building Safety Regulator under the Building Safety Act? Comment	N/A
Will this FRA be shared will all Accountable Persons for the premises?	Yes
Comment	
How will this sharing be achieved?	These are held on M files for all to access
Are there other Responsible Persons who share or have fire safety duties in respect of the premises?	Yes
Have all details required by regulations been shared with all other Responsible Persons?	Yes
Comment	
Have all details required by regulations to be shared with us from other Responsible Persons been received and recorded?	Yes
Comment	
Will this FRA be shared will all other Responsible Persons for the	Yes

premises?
Comment
How will this sharing be achieved?
There are held on M files for all to access

Is an office or IL scheme being inspected? No
Comment

Passenger Lift

Is the scheme fitted with a passenger lift?	No
Comment	

Premises Inspection Box

Is there a premises information box for fire & rescue service use?	
Comment	

Evacuation Policy

Are there suitable arrangements for summoning the fire service?

Comment

Taking FRA findings, is the evacuation policy appropriate for the scheme as per latest guidance?

Comment

Observation

Evacuation policy posted in the notice boards located in the main entrances of every block



Yes

Priority

It's the responsibility of the customers to summon the emergency services Yes

Required By:

Task ID



Referred To

Engagement with Residents

Has information of fire procedures been disseminated to residents?	Yes
Comment	
Is general fire safety information disseminated to residents?	Yes
Comment	

FRA Frequency

Taking the findings of this assessment into account, is the frequency of	Yes
the FRA correct?	
Comment	

Miscellaneous

Are there any other observations/actions to raise that are not covered above.	No
Are there fire related remedial works required at this property, that will affect the fabric of the building?	No
Comment	
Were there any unsatisfactory aspects of the Fire Risk Assessment? (Visible on Building Safety Report).	No

Risk Calculator - Fire

The following risk estimator is based on the general health and safety risk level estimator contained within BS 8800: 1996. Guide to occupational health and safety management systems.

1. Taking into account the fire prevention measures observed at the time of this risk assessment, it is considered that the hazard from the fire (the probability of ignition) at this building is:

LOW	X	MEDIUM	НІGН	
-----	---	--------	------	--

2. Taking into account the nature of the building, the occupants, the fire protection afforded and any procedural arrangements observed at the time of the assessment, it is considered that the consequences for life safety in the event of a fire would be:

MINOR	MAJOR	X	CRITICAL	
		Λ		

The definition of the above terms is as follows: *FRA Review Frequency*

MINOR	Outbreak of fire is unlikely to result in serious injury or death of any occupant (other than the occupant sleeping in a bedroom in which a fire occurs).
MAJOR	An outbreak of fire could result in injury of one or more occupants, but is unlikely to lead to fatalities.
CRITICAL	There is significant potential for serious injury or death of one or more occupants.

3. The above estimates are then read into the following matrix table to give the overall risk level for the site:

Fire Hazard	Minor	Major	Critical
Low	Trival	Tolerable	Moderate
Medium	Tolerable	Moderate	Substantial
High	Moderate	Substantial	intolerable

When the level of risk is established, the action level can be read from the table below:

Asset ID: 24423

Horseshoe Crescent

Risk Level	Guide to actions and appropriate timescales
Trivial	No action is required
Moderate	Efforts should be made to reduce the risk level and this should be carried out within the specified time periods.
Substantial	Considerable resources may have to be allocated to reduce the risk level. It may be necessary to limit the occupation of some parts until urgent remedial action is taken.
Intolerable	The building (or the relevant area) should not be occupied until the risk is reduced.

The Overall Risk Level for this asset is:	Trivial	