

This report shows all the responses to the Fire Risk Assessment survey, including raised tasks.

Asset ID: 24574 **Derek Horn Court**

Cover Sheet

Photo



Date of Fire Risk Assessment	05 Apr 2024
Date of Next Fire Risk Assessment	05 Apr 2025
FRA Frequency (Months)	12
Purpose of Fire Risk Assessment	Annual Re-Assessment
Type of Fire Risk Assessment	Type 1 (Common Parts Only - Non Destructive)
Fire & Safety Assessor	Gary Bredin

It is sensible to have arrangements in place to ensure the consistency of Fire Risk Assessments in terms of the assessment of risk and mitigations proposed. In this regard Accent peer validate around 20% of reports, which are available within our audit system.

The Scheme

Scheme Name	Derek Horn Court
Scheme Address	Derek Horn Court
Postcode	GU15 3JL
Region	South
Scheme Manager	Lorraine Jinman
Scheme Tel. No	
Scheme Inspection Completed	Yes
Enforcing Fire Authority	Surrey Fire and Rescue service
Other staff in attendance	Lorraine Linman
Number of on-site Accent staff	Scheme Manager Weekdays
Number of other (non-Accent) staff	Contract Cleaners in common areas

The Building

Accommodation Type	CAT2 Housing for Older People (S28)
Build Date	Jan 1 1990
Number Of Homes	34
Homes breakdown	Flat
External wall construction	Facing Brick
External wall finish	Cement Render, Facing Brick, Timber Clad
Roof construction	Timber
Roof covering	Interlocking Pitched
PEEPs in place where necessary	Yes
Current Evacuation Strategy	Stay Put (Delayed) Evacuation
Conversion or purpose-built	Purpose Built
Number of storeys	3
Number of floors on which car parking is provided	0
Is there a habitable basement?	No
Number of internal Staircases (protected or unprotected?)	3 Protected
Number of External Staircases	None
External Balcony part of escape route?	N/A
Unusual features	None
Building Access Conditions for Fire Brigade	Vehicular Access to one or more elevations

Asset ID: 24574 Derek Horn Court

Fire Detection and Warning System	Flats and common areas linked
Grade of fire alarm	Grade A
Category of fire alarm	LD2 Additional Protection
Emergency Lighting Provision	Non Maintained System - Common Areas
Portable Fire Extinguishers supplied/fitted	Yes
Fixed Fire Fighting Installations	No

Customers

Number of occupants	50
Occupant tenure type breakdown	CAT2 Housing for Older People, Sheltered Schemes

Fire Safety Related Customer Safety Servicing

Overdue communal gas safety checks	0
Overdue domestic gas safety checks	0
Overdue communal electrical condition checks	0
Overdue domestic electrical condition checks	0
Overdue alarm call pull chord tests	0
Overdue communal PAT testing	0
Overdue customer mobility scooter PAT testing	0
Overdue Monthly Emergency Lighting Switch Tests	1
Overdue Annual Emergency Lighting tests	1
Overdue Weekly Fire Alarm Testing	1
Overdue Fire Panel - Six Monthly Testing	1
Overdue Fire Safety Equipment tests	1

Building Fire Safety Surveys - Communal Doors

Failing Communal Fire Doors	0
Communal Fire doors due for replacement within 5 years	0

Dwelling Doors

Failing Dwelling Fire Doors	0
Dwelling Fire doors due for replacement within 5 years	0

Fire Risk Assessment Survey Results

Scheme and Building Information

Photo



Date of Fire Risk Assessment	05/04/2024
FRA Frequency (Months)	12
Purpose of Fire Risk Assessment	Annual Re-Assessment
Type of Risk Assessment	Type 1 (Common Parts Only - Non Destructive)
Quantity	1
Fire & Safety Assessor	Gary Bredin
Enforcing Fire Authority	Surrey Fire and Rescue service
Scheme Tel. No	
Other staff in attendance	Lorraine Linman
Number of on-site Accent staff	Scheme Manager Weekdays
Number of other (non-Accent) staff	Contract Cleaners in common areas
Scheme Inspection completed	Yes
Number of occupants	50
Personal Emergency Evacuation Plans in place	Yes
Current Evacuation Strategy	Stay Put (Delayed) Evacuation
Conversion or purpose-built	Purpose Built
Number of Storeys	3
Number of floors on which car parking is provided	0
Is there a habitable basement?	No
No. of internal staircases (protected/unprotected)	3 Protected
Number of external staircases	None
External balcony part of escape route?	N/A
Unusual features	None

Fire Risk Assessment Survey Results

Building access conditions for Fire Brigade	Vehicular Access to one or more elevations
Surroundings: Residential/Commercial	Residential
Fire Detection and Warning System	Flats and common areas linked
Grade of Fire Alarm	Grade A
Category of Fire Alarm	LD2 Additional Protection
Emergency Lighting Provision	Non Maintained System - Common Areas
Portable Fire Extinguishers / Fire Blankets supplied / fitted	Yes
Water Extinguisher(s) present	No
Foam Extinguisher(s) present	Yes
Dry Powder Extinguisher(s) present	No
Carbon Dioxide Extinguisher(s) present	Yes
Fire Blanket(s) present	Yes
Fixed Fire Fighting Installations supplied / fitted	No
Dry Riser(s) present	No
Wet Riser(s) present	No
Sprinkler System present	No
Hosereel(s) present	No
Automatic Opening Vent(s) present	No

Electrical Sources of Ignition

Electrical installation within common areas in good condition and no obvious damage?	Yes
Comment	
Valid Electrical Installation Condition Reports held on file? (Common Areas & General Needs Flats)	Yes
Comment	Due date 28th April 2026
Electrical App/PA Testing - tested within past 12 months?	Yes
Comment	
Absence of trailing leads and adapters?	Yes
Comment	
Evidence that mobility scooters are not being stored/charged in common areas?	Yes
Comment	Housing Partner dealing.
Is there a purpose built mobility scooter store/charging area?	No

Comment

Does the building have a lightning protection system? Yes

Comment

Is the protection system adequately maintained?

Comment

Observation	Priority	Referred To	Required By:	Task ID
-------------	----------	-------------	--------------	---------

PAT all in date. Minimal use of extn leads within the communal areas.



Gas installations

Is there a commercial/domestic gas supply to the scheme? Yes

Comment

Valid LGSR held on file for fixed communal area gas appliances? (Boilers) Yes

Comment Next test 10th August 2024

Valid LGSR held on file for residential flats that contains gas appliances? N/A

Comment No gas supply to the flats.

Are smoke/heat detectors within General Needs flats subject to an annual inspection and the results Yes

Comment

Other Sources of Ignition

Is there a no smoking policy in place, which is enforced and adhered to? Yes

Comment

Adequate security against arson? Yes

Comment

Are refuse/recycling bin areas managed and suitably located? Yes

Comment Checked and clear at the time of the audit.

Are there communal cooking facilities at this scheme?	Yes
Comment	Only used for events and warming food.
Are reasonable measures taken to prevent fires as a result of cooking?	Yes
Comment	
Where there is extraction in communal kitchens, are filters and ductwork changed/cleaned regularly?	Yes
Comment	

Housekeeping

Are all electrical/intake/service cupboards secure and free from general waste, contractors waste and residents personal items?	Yes
Comment	
Are unnecessary accumulations of combustible materials or waste avoided?	Yes
Comment	
Are combustible materials and substances separated from ignition sources and stored appropriately?	Yes
Comment	
Furniture/furnishings in good condition, fire retardant/resistant and comply with modern standards and regulations?	Yes
Comment	

Other Significant Fire Hazards

Are all other significant fire hazards adequately controlled?	Yes
Comment	

Means of Escape from Fire

Is it considered that the building is provided with reasonable means of escape in case of fire?	Yes
Comment	
Escape routes unobstructed and safe to use?	Yes
Comment	
Exits immediately openable without a key and/or failsafe's function correctly?	Yes
Comment	
Reasonable distances of travel where there is a single/alternative direction of travel?	Yes
Comment	

Escape routes lead to final exits and open in direction of escape where necessary? Yes

Comment

Observation **Priority** **Referred To** **Required By:** **Task ID**

Generally areas were clear during the audit. All stairs were in good order.



Observation **Priority** **Referred To** **Required By:** **Task ID**

Mobile scooter was found in the means of escape. Housing Partner dealing.

Internal - High

Housing Partner

04/04/2024

1802148



Fire Spread and Development

Is it considered that the compartmentation is of a reasonable standard? Yes

Comment

Is there reasonable limitation of surface finishes that might promote fire spread (walls, floors, ceilings)? Yes

Comment

Are fire dampers/shutters provided in ducts/refuse chutes to protect means of escape against fire, smoke and combustion products? N/A

Comment

As far as can be reasonably ascertained, is the compartmentation within roof spaces of a satisfactory standard? Yes

Comment

Loft hatches fire resisting? Yes

Comment

Asset ID: 24574

Derek Horn Court

As far as can be reasonably ascertained, is the fire stopping above cross corridor fire doors within suspended ceiling void of a satisfactory standard?

Yes

Comment

Do external walls, doors, windows and anything attached to the exterior, limit fire spread?

Yes

Comment

If Smoke Control Systems (AOV's) are fitted, are the records of annual testing available?

N/A

Comment

Are roller shutter doors that are required to be FR, fire resisting and self-closing?

Comment

Observation	Priority	Referred To	Required By:	Task ID
Some door guards were failing the test. Recommendation change all the batteries. Housing Partnered dealing with assistance from the Fire Risk Assessor.	Internal - Medium	Housing Partner	24/04/2024	1802149



Observation	Priority	Referred To	Required By:	Task ID
Spot check on 3 chairs all these conform to BS7176 2007				



Emergency Escape Lighting

Is the emergency lighting correctly specified and installed as per current standards?

Yes

Comment

Emergency lighting units in good condition and securely fixed to walls/ceilings? Yes

Comment

Records of monthly/annual testing available? Yes

Comment

Fire Safety Signs and Notices

Are the correct Fire Action/Advice notices displayed in prominent locations within the common areas? Yes

Comment

Directional fire escape signage in place and adequate? Yes

Comment

Is there suitable LIFT signage i.e. do not use in case of fire? Yes


Comment

Do common area fire doors display the correct signage on both sides where applicable? Yes

Comment

Observation **Priority** **Referred To** **Required By:** **Task ID**

Emergency action notices are located throughout the scheme. The evacuation policy is also posted in the notice boards.

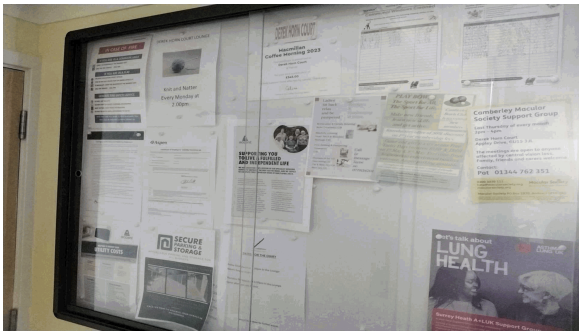

Means of giving Warning in case of Fire

Is the scheme fitted with a communal area fire alarm? Yes

Comment

Fault showing on the system. Contractors aware and are dealing. Sounder fault.

Is fire detection and warning system appropriate for occupancy and fire risk, as per BS 5839-1:2017? Yes

Comment

Is the fire detection and warning system maintained/tested and all certificates saved on file? Yes

Asset ID: 24574

Derek Horn Court

Comment

Fire alarm components in good condition and securely fixed to walls/ceilings?

Yes

Comment

Hold open devices operate at the sounding of the alarm and are in a serviceable condition?

No

Comment

Some failed the test. All batteries will be changed by the Housing partner.

Are there heat detectors located in the Kitchen, Boiler, Plant Room and Laundry?

Yes

Comment

Is the fire alarm panel remotely monitored, and if so are there records of regular testing?

Yes

Comment

Monitored by Astraline out of hours.

Fire Extinguishing Equipment

Is fire extinguishing equipment and/or fixed fire fighting installations provided at this scheme?

Yes

Comment

Portable fire extinguishers - appropriate type/number/position?

Yes

Comment

Correct signage displayed by each fire extinguisher?

Yes

Comment

Fire blanket in communal kitchen, secured to the wall, complete with signage?

Yes

Comment

Dry risers - Inlet/outlet boxes secured and/or securing straps fitted to outlet valves?

N/A

Comment

Records available of fire fighting equipment servicing within past 12 months?

Comment

Observation _____ Priority _____ Referred To _____ Required By: _____ Task ID _____

All extinguishers were in date at the time of the audit



Management of Fire Safety

Are these premises regulated by the Building Safety Regulator under the Building Safety Act? No

Comment

Are there other Responsible Persons who share or have fire safety duties in respect of the premises? Yes

Have all details required by regulations been shared with all other Responsible Persons? Yes

Comment

Have all details required by regulations to be shared with us from other Responsible Persons been received and recorded? N/A

Comment

Will this FRA be shared will all other Responsible Persons for the premises? Yes

Comment

How will this sharing be achieved? All kept on Mfiles and can be seen on request.

Is an office or IL scheme being inspected? Yes

Comment

IL Schemes & Regional Offices - Are there sufficient numbers of qualified Fire wardens?

Comment

Offices - Are there suitable arrangements for ensuring the premises are evacuated? Yes

Comment

Offices - Are there suitable arrangements for evacuating disabled people? Yes

Comment

Offices - Suitable arrangements for meeting the fire service on arrival and proving relevant information? Yes

Comment

Asset ID: 24574 Derek Horn Court

Offices/IL Schemes - Is there a suitable assembly point? Yes

Comment located in the car park

Offices - Are fire drills carried out at appropriate intervals?

Comment

Passenger Lift

Is the scheme fitted with a passenger lift? Yes

Comment

Is the lift in full working order at the time of the FRA? Yes

Comment

Is the lift fitted with a firefighters switch? No

Comment

Servicing and insurance inspection - Evidence of regular servicing/maintenance? Yes

Comment All details logged on M Files.

Observation **Priority** **Referred To** **Required By:** **Task ID**

All in good order correct signage noted.



Premises Inspection Box

Is there a premises information box for fire & rescue service use? No

Comment

Evacuation Policy

Are there suitable arrangements for summoning the fire service? Yes

Comment

Taking FRA findings, is the evacuation policy appropriate for the scheme as per latest guidance? Yes

Comment

Engagement with Residents

Has information of fire procedures been disseminated to residents? Yes

Comment

Is general fire safety information disseminated to residents? Yes

Comment

FRA Frequency

Taking the findings of this assessment into account, is the frequency of the FRA correct? Yes

Comment

Miscellaneous

Are there any other observations/actions to raise that are not covered above. No

Are there fire related remedial works required at this property, that will affect the fabric of the building? No

Comment

Were there any unsatisfactory aspects of the Fire Risk Assessment? (Visible on Building Safety Report). No

Risk Calculator - Fire

The following risk estimator is based on the general health and safety risk level estimator contained within BS 8800: 1996. Guide to occupational health and safety management systems.

1. Taking into account the fire prevention measures observed at the time of this risk assessment, it is considered that the hazard from the fire (the probability of ignition) at this building is:

LOW MEDIUM HIGH

2. Taking into account the nature of the building, the occupants, the fire protection afforded and any procedural arrangements observed at the time of the assessment, it is considered that the consequences for life safety in the event of a fire would be:

MINOR MAJOR CRITICAL

The definition of the above terms is as follows:

FRA Review Frequency

MINOR	Outbreak of fire is unlikely to result in serious injury or death of any occupant (other than the occupant sleeping in a bedroom in which a fire occurs).
MAJOR	An outbreak of fire could result in injury of one or more occupants, but is unlikely to lead to fatalities.
CRITICAL	There is significant potential for serious injury or death of one or more occupants.

3. The above estimates are then read into the following matrix table to give the overall risk level for the site:

Fire Hazard	Minor	Major	Critical
Low	Trivial	Tolerable	Moderate
Medium	Tolerable	Moderate	Substantial
High	Moderate	Substantial	Intolerable

When the level of risk is established, the action level can be read from the table below:

Risk Level	Guide to actions and appropriate timescales
Trivial	No action is required
Moderate	Efforts should be made to reduce the risk level and this should be carried out within the specified time periods.
Substantial	Considerable resources may have to be allocated to reduce the risk level. It may be necessary to limit the occupation of some parts until urgent remedial action is taken.
Intolerable	The building (or the relevant area) should not be occupied until the risk is reduced.

The Overall Risk Level for this asset is: **Trivial**