Fire Risk Assessment Report



This report shows all the responses to the Fire Risk Assessment survey, including raised tasks.

Asset ID: 24621 Imperial Court

Cover Sheet

Photo

Partie Col

Date of Fire Risk Assessment

Date of Next Fire Risk Assessment

FRA Frequency (Months)

Purpose of Fire Risk Assessment

Type of Fire Risk Assessment

Fire & Safety Assessor

07 Nov 2024

07 Nov 2027

36

3 year Re-Assessment

Type 1 (Common Parts Only - Non Destructive)

Gary Bredin AlFireE

It is sensible to have arrangements in place to ensure the consistency of Fire Risk Assessments in terms of the assessment of risk and mitigations proposed. In this regard Accent peer validate around 20% of reports, which are available within our audit system.

The Scheme

Scheme Name Imperial Court

Scheme Address Imperial Court

Postcode GU15 3HQ

Region South

Scheme Manager

Scheme Tel. No -

Scheme Inspection Completed Yes

Enforcing Fire Authority Surrey Fire and Rescue service

Other staff in attendance None

Number of on-site Accent staff None

Number of other (non-Accent) staff

Contract Cleaners in common areas

The Building

Accommodation Type General Needs (S30), Peerless General Needs -

LSVT (S29)

Build Date Jan 15 2004

Number Of Homes 13

Homes breakdown Flat

External wall construction Facing Brick

External wall finish Facing Brick

Roof construction Timber

Roof covering Flat Roof

PEEPs in place where necessary N/A

Current Evacuation Strategy Stay Put (Delayed) Evacuation

Conversion or purpose-built Conversion

Number of storeys 3

Number of floors on which car parking is provided 0

Is there a habitable basement?

Number of internal Staircases (protected or unprotected?)

One protected

Number of External Staircases None

External Balcony part of escape route? N/A

Unusual features None

Building Access Conditions for Fire Brigade

Vehicular Access to one or more elevations

Imperial Court Asset ID: 24621 Flats only Fire Detection and Warning System Grade D Grade of fire alarm Category of fire alarm LD3 Minimum Protection **Emergency Lighting Provision** Non Maintained System - Common Areas Portable Fire Extinguishers supplied/fitted No Fixed Fire Fighting Installations No **Customers** 30 Number of occupants **General Needs** Occupant tenure type breakdown Fire Safety Related Customer Safety Servicing Overdue communal gas safety checks 0 0 Overdue domestic gas safety checks 0 Overdue communal electrical condition checks 0 Overdue domestic electrical condition checks Overdue alarm call pull chord tests 0 Overdue communal PAT testing 0 0 Overdue customer mobility scooter PAT testing Overdue Monthly Emergency Lighting Switch Tests 0 Overdue Annual Emergency Lighting tests Overdue Weekly Fire Alarm Testing 0 Overdue Fire Panel - Six Monthly Testing 1 Overdue Fire Safety Equipment tests 1 **Building Fire Safety Surveys - Communal Doors** 0 Failing Communal Fire Doors Communal Fire doors due for replacement within 5 years 0 **Dwelling Doors** Failing Dwelling Fire Doors 0

Dwelling Fire doors due for replacement within 5 years

0

Fire Risk Assessment Survey Results

Scheme and Building Information

Photo



Date of Fire Risk Assessment

FRA Frequency (Months)

Purpose of Fire Risk Assessment

Type of Risk Assessment

Quantity

Fire & Safety Assessor

Enforcing Fire Authority

Scheme Tel. No

Other staff in attendance

Number of on-site Accent staff

Number of other (non-Accent) staff

Scheme Inspection completed

Number of occupants

Personal Emergency Evacuation Plans in place

Current Evacuation Strategy

Conversion or purpose-built

Number of Storeys

Number of floors on which car parking is provided

Is there a habitable basement?

No. of internal staircases (protected/unprotected)

Number of external staircases

External balcony part of escape route?

Unusual features

07/11/2024

36

3 year Re-Assessment

Type 1 (Common Parts Only - Non Destructive)

1

Gary Bredin AlFireE

Surrey Fire and Rescue service

-

None

None

Contract Cleaners in common areas

Yes

30

N/A

Stay Put (Delayed) Evacuation

Conversion

3

0

No

One protected

None

N/A

None

Fire Risk Assessment Survey Results

Building access conditions for Fire Brigade

Vehicular Access to one or more elevations

Surroundings: Residential/Commercial Mixed

Fire Detection and Warning System Flats only

Grade of Fire Alarm Grade D

Category of Fire Alarm LD3 Minimum Protection

Emergency Lighting Provision Non Maintained System - Common Areas

Portable Fire Extinguishers / Fire Blankets supplied / fitted No

Water Extinguisher(s) present

Foam Extinguisher(s) present No

Dry Powder Extinguisher(s) present No

Carbon Dioxide Extinguisher(s) present No

Fire Blanket(s) present

Fixed Fire Fighting Installations supplied / fitted No

Dry Riser(s) present No

Wet Riser(s) present No

Sprinkler System present No

Hosereel(s) present No

Automatic Opening Vent(s) present No

Electrical Sources of Ignition

Electrical installation within common areas in good condition and no

obvious damage?

Comment

Valid Electrical Installation Condition Reports held on file? (Common

Areas & General Needs Flats)

Comment Next Electrical safety check February 2026

Yes

Yes

Electrical App/PA Testing - tested within past 12 months?

N/A

Comment

Absence of trailing leads and adapters? Yes

Comment

Evidence that mobility scooters are not being stored/charged in Yes

common areas?

Comment

Is there a purpose built mobility scooter store/charging area?

Comment

Does the building have a lightning protection system?

N/A

Comment

Is the protection system adequately maintained?

Comment

Observation Priority Referred To Required By: Task ID

Internal - Medium

No

Electrical switches have been removed and taped up. These require reinstating. Surveyor dealing. Job raised.





Gas installations

Is there a commercial/domestic gas supply to the scheme?

Comment

Other Sources of Ignition

Is there a no smoking policy in place, which is enforced and adhered Yes

to? Comment

Adequate security against arson?

Comment Electronic entry system in place

Are refuse/recycling bin areas managed and suitably located? Yes

Comment Satisfactory location of the bin area

Are there communal cooking facilities at this scheme?

Comment

Housekeeping

Are all electrical/intake/service cupboards secure and free from general Yes

waste, contractors waste and and residents personal items?

Comment All clear at the time of the audit

Imperial Court Asset ID: 24621

Are unnecessary accumulations of combustible materials or waste

avoided?

Comment

Are combustible materials and substances separated from ignition

sources and stored appropriately?

Comment

Furniture/furnishings in good condition, fire retardant/resistant and

comply with modern standards and regulations?

Comment

Observation

Priority

Satisfactory location of the bin store.



Other Significant Fire Hazards

Are all other significant fire hazards adequately controlled?

Comment

Means of Escape from Fire

Is it considered that the building is provided with reasonable means of

escape in case of fire?

Comment

Escape routes unobstructed and safe to use?

Comment

Exits immediately openable without a key and/or failsafe's function

correctly?

Comment

Reasonable distances of travel where there is a single/alternative

direction of travel?

Comment

Escape routes lead to final exits and open in direction of escape where

necessary?

Yes

Yes

N/A

N/A

Referred To

Required By:

Task ID

Yes

No

Some items are being left in the communal area

outside flat 7. Housing partner dealing.

Yes

Yes

Yes

MIS-AMS ActiveH - Fire Risk Assessment Report

Page 7 of 14

Generated 07/11/2024 16:02:56

Comment

Rear door opens inwards this is to assist disabled

use.

Yes

Observation Priority Referred To Required By: Task ID

All stairwells were clear at the time of the audit





Observation Priority Referred To Required By: Task ID

Items are being left in the communal area outside flat 7. Housing partner dealing.



Fire Spread and Development

spread (walls, floors, ceilings)?

Is it considered that the compartmentation is of a reasonable standard?

Comment

Is there reasonable limitation of surface finishes that might promote fire Yes

Comment

Are fire dampers/shutters provided in ducts/refuse chutes to protect N/A means of escape against fire, smoke and combustion products?

Comment

As far as can be reasonably ascertained, is the compartmentation N/A within roof spaces of a satisfactory standard?

Comment This area was not checked during the audit

Loft hatches fire resisting?

Comment No loft hatches found during the audit.

Imperial Court Asset ID: 24621

As far as can be reasonably ascertained, is the fire stopping above cross corridor fire doors within suspended ceiling void of a satisfactory standard?

Comment

Do external walls, doors, windows and anything attached to the

exterior, limit fire spread?

Comment

If Smoke Control Systems (AOV's) are fitted, are the records of annual

Comment

Are roller shutter doors that are required to be FR, fire resisting and self-closing?

Comment

Observation

N/A


Priority

Yes

Yes

N/A

All electrical intake cupboards were clear at the time of

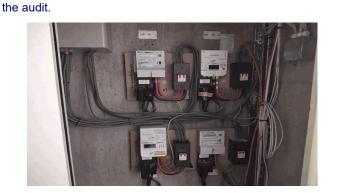



Referred To

Required By:

Task ID

Emergency Escape Lighting

Is the emergency lighting correctly specified and installed as per current standards?

Comment

Comment

Emergency lighting units in good condition and securely fixed to walls/ceilings?

Comment

Records of monthly/annual testing available?

Yes

Yes

Yes

Comment Last drop test September 2024

Fire Safety Signs and Notices

Are the correct Fire Action/Advice notices displayed in prominent

locations within the common areas?

Directional fire escape signage in place and adequate?

These are located throughout the building

Yes

Yes

MIS-AMS ActiveH - Fire Risk Assessment Report

Page 9 of 14

Generated 07/11/2024 16:02:56

Comment

Is there suitable LIFT signage i.e. do not use in case of fire?

Comment

Do common area fire doors display the correct signage on both sides

where applicable?

Comment

Observation Priority Referred To Required By: Task ID

Yes

No

Yes

Emergency action notices posted in the notice boards located in the main entrance.



Means of giving Warning in case of Fire

Is the scheme fitted with a communal area fire alarm?

Comment

Fire Extinguishing Equipment

Is fire extinguishing equipment and/or fixed fire fighting installations No provided at this scheme?

Comment

Management of Fire Safety

Are these premises regulated by the Building Safety Regulator under the Building Safety Act?

Comment

Comment

Comment

Are there other Responsible Persons who share or have fire safety
duties in respect of the premises?

Have all details required by regulations been shared with all other

Yes

Responsible Persons?

Have all details required by regulations to be shared with us from other

Responsible Persons been received and recorded?

MIS-AMS ActiveH - Fire Risk Assessment Report

Page 10 of 14

Generated 07/11/2024 16:02:56

Imperial Court Asset ID: 24621 Yes Will this FRA be shared will all other Responsible Persons for the premises? This will be available on M Files. Comment How will this sharing be achieved? The FRA will be available on request. Is an office or IL scheme being inspected? N/A Comment IL Schemes & Regional Offices - Are there sufficient numbers of N/A qualified Fire wardens? Comment N/A Offices - Are there suitable arrangements for ensuring the premises are evacuated? Comment N/A Offices - Are there suitable arrangements for evacuating disabled people? Comment N/A Offices - Suitable arrangements for meeting the fire service on arrival and proving relevant information? Comment N/A Offices/IL Schemes - Is there a suitable assembly point? Comment Offices - Are fire drills carried out at appropriate intervals? N/A Comment Passenger Lift Yes Is the scheme fitted with a passenger lift? Comment Is the lift in full working order at the time of the FRA? Yes Comment Is the lift fitted with a firefighters switch? No Comment Servicing and insurance inspection - Evidence of regular Yes servicing/maintenance? Comment Last test September 2024 **Premises Inspection Box**

Comment

Is there a premises information box for fire & rescue service use?

No

Evacuation Policy

Are there suitable arrangements for summoning the fire service?

Comment

Taking FRA findings, is the evacuation policy appropriate for the scheme as per latest guidance?

Comment

Yes

It's the responsibility of customers to summon the emergency services

Yes

Engagement with Residents

Has information of fire procedures been disseminated to residents?

Comment

Is general fire safety information disseminated to residents?

Comment

Yes

Yes

All safety information is posted on the notice board

in the main entrance

FRA Frequency

Taking the findings of this assessment into account, is the frequency of the FRA correct?

Comment

Yes

Miscellaneous

Are there any other observations/actions to raise that are not covered above.

Are there fire related remedial works required at this property, that will affect the fabric of the building?

Comment

Were there any unsatisfactory aspects of the Fire Risk Assessment? (Visible on Building Safety Report).

No

No

No

Risk Calculator - Fire

The following risk estimator is based on the general health and safety risk level estimator contained within BS 8800: 1996. Guide to occupational health and safety management systems.

systems.					
	•			he time of this risk obability of ignition) at	this
LOW		MEDIUM	X	нідн	
	rrangements obs	served at the time	e of the assess	the fire protection afforment, it is considered	
MINOR		MAJOR	X	CRITICAL	

The definition of the above terms is as follows: FRA Review Frequency

MINOR	Outbreak of fire is unlikely to result in serious injury or death of any occupant (other than the occupant sleeping in a bedroom in which a fire occurs).
MAJOR	An outbreak of fire could result in injury of one or more occupants, but is unlikely to lead to fatalities.
CRITICAL	There is significant potential for serious injury or death of one or more occupants.

3. The above estimates are then read into the following matrix table to give the overall risk level for the site:

Fire Hazard	Minor	Major	Critical
Low	Trival	Tolerable	Moderate
Medium	Tolerable	Moderate	Substantial
High	Moderate	Substantial	Intolerable

When the level of risk is established, the action level can be read from the table below:

Risk Level	Guide to actions and appropriate timescales
Trivial	No action is required
Moderate	Efforts should be made to reduce the risk level and this should be carried out within the specified time periods.
Substantial	Considerable resources may have to be allocated to reduce the risk level. It may be necessary to limit the occupation of some parts until urgent remedial action is taken.
Intolerable	The building (or the relevant area) should not be occupied until the risk is reduced.

The Overall Risk Level for this asset is:	Moderate	